

JAN 2 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee

(County)


Located in:

Corner Code #



LIBER 1

PAGE 420

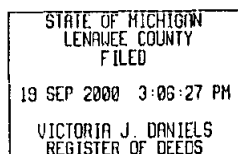

1. Public Land Survey

T - 5 - S R - 2 - E

H-3

T _____ R _____

T _____ R _____

T _____ R _____

2. Property Controlling
in Section

S _____ T _____ R _____

S _____ T _____ R _____

3. Miscellaneous
Property in Sec

S _____ T _____ R _____

S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Glenn E. Richard in a field survey on July 5, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 Hervey Parke D.S. set post Poplar 6 S 78 1/2 E 5 Poplar 6 S 60 W 35
1948 Kenneth Suydam shows the corner of his field notes but not type of monumentation
1949 The notes for Allen Lake state Public Fishing site by D.N.R. "S 1/4 Found 1" X 24" pipe & brass tubing. Replaced with 4" X 42" Mon't (pipe)"
1952 Walter Frazier found "Conservation monument"
1953 Werner Sommer shows the corner but not type of monumentation
1995 Michael Bartolo found 3/4" iron pipe which checked to the monumentation that was shown on the surveys by Walter Frazier & Werner Sommer and recorded it in Liber 5, Page 258

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

July 5, 2000 The corner is approximately 100'± Southeasterly along Killarney Highway and 160'± Southwesterly from the intersection of US-12 and Killarney Hwy. The 1952, 1953 and 1995 survey notes call for the corner to be 3' in front of the house. It has been remodeled and a large 12' wood deck is over the location of the corner. I found the two iron pipes called for in the 1953 and 1995 surveys.
July 14, 2000 Kevin Pickford P.S. 46682 crawled under the deck and found Michigan Conservation Department Monument 15" deep.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Michigan Conservation Department monument under wood deck and is accepted as the best available evidence of the position of the original corner.

W. face of foundation N 55 E 3.08 residence #11978 Killarney Hwy.
S. face of conc. block wall N 25 W 5.36
SE'ly corner of conc. block foundation S 35° E 23.39
Center of top on well casing 90.07 S 30° E 23.44
NE'ly corner of cottage #11974 foundation S 10° W 83.70
NW'ly corner of cottage #11974 foundation S 15° W 90.85
Reference Mon. S 25° 48' 32" E 30.34
Reference Mon. N 78° 33' 15" E 123.50

(See Sketch on Back)



Ratified by Peer Group in accordance with P.A. 345 Co. Glenn E. Richard Date August 8, 2000

Signed by Glenn E. Richard Date Sept. 15, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040

JAN 22 2001




01 421 2

LIBER 1

PAGE 421

SECTION

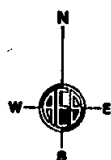

NOT TO SCALE

