

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____ T. <u>42</u> N. <u>6</u> W.		K-9
2. PROPERTY CONTROLLING IN SECTION <u>25</u> T. <u>42</u> N. <u>6</u> W.		5-Sec.25, L-10
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. _____ S. _____ R. _____ E. _____ W.		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-22, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

K-9 Section Corner 23-24-25-26, recorded by L. Fiendt, R.L.S.

5-Sec.25 North 1/16 Corner of Section 25.

L-10 Center Corner of Section 25.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

K-9 Found 5/8" Iron Rod as recorded by L. Fiendt R.L.S.

5-Sec.25 Placed corner midway bet. Center Corner and the North 1/4 Corner.

L-10 Placed corner in the N-S 1/4 Line and on a line between a Plat Monument to West and a "T" Iron placed for the East 1/16 Corner. The Plat located by L. Fiendt, R.L.S. and the "T" Iron set by unknown party.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Placed 1" pipe with 4" aluminum cap at all three corners. Bearings are:

K-9 10" Hemlock, S37°W, 17.5' & 12" W. Pine, N49°W, 53.5' & 12" S. Maple, S35°E, 35.4'. Corner lies 50' South of Little Brevoort Lake Camp Gound Road.

5-Sec.25 16" Twin Oak, S49°W, 62.0' & 12" W. Pine, N62°W, 42.5' & 12" Oak, N43°E, 33.0'. Corner lies 60' South of an old E-W Road.

L-10 18" W. Pine, East, 16.0' & 14" Oak, N58°W, 30.3'.

SIGNED BY Billy D. Buckler DATE 9-29-80
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

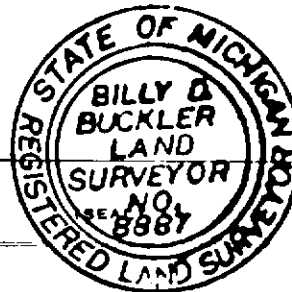

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
 CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
 MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET