

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

4 Corners.

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. <u>3</u> , R. <u>11</u> W.	<u>E-11, E-12, D-11, C-11</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-31 & 6-1, 19 79, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19 _____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Wm. Ives in 1849. Bearings were:

- E-11 Sec. Cor. 28-29-32-33: Cedar 8", S26°E, 24 lks. & Spruce 8", N16°W, 21 lks.
- E-12 Quarter Corner bet. Sec's. 32-33: Cedar 7" for corner & Cedar 6", S35°E, 12 lks.
- D-11 Quarter Corner bet. Sec's. 29-32: Sugar 14", S45°W, 17 lks. & Y. Birch 8", N60°E, 21 lks.
- C-11 Sec. Cor. 29-30-31-32: Hemlock 16", S56°E, 22 lks. & Hemlock 16", N49°W, 27 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-11 Placed corner in center of N-S road and by single proportion measure to corners North and South.
- E-12 Placed corner midway and on line bet. two Sec. Corners, in N-S road.
- D-11 Placed corner midway and on line bet. two Sec. Corners. Found no evidence of original corner.
- C-11 Placed corner on old N-S grade and by single prop. measure to North and South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-11 & E-12 Buried a 36" "T" Iron in road. D-11 & C-11 Placed 1" pipe with 4" Aluminium cap.

- E-11 New Bearings: 12" Cedar, N63°E, 44.8' & 12" Cedar, S79°E, 32.3' & 10" W. Pine, S89°W, 57.2'
 - E-12 "T" Iron in East edge of N-S road. 12" Cedar, N84°W, 31.6' & 10" Tamarack, N45°E, 61.3' & 6" Tamarack, S59°E, 48.8'.
 - D-11 6" Cedar, S49°W, 36.8' & 12" Spruce, N62°W, 15.7' & 14" Spruce, East, 45.2'.
 - C-11 24" Hemlock, N44°W, 52.6' & 16" S. Maple, N75°E, 44.1' & 10" S. Maple, S46°W, 53.4'
- Corner lies on South edge of E-W road.

SIGNED BY


Billy D. Buckler

DATE 10-8-79

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO.

8887

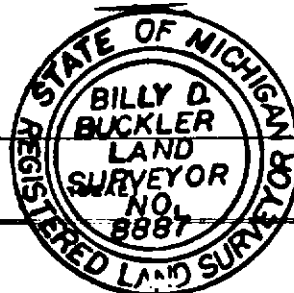

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY

DATE

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY

DATE

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____