

**SURVEY &  
REMONUMENTATION**

MECOSTA COUNTY REMONUMENTATION PROGRAM  
CORNER APPROVED BY PEER GROUP ON 12 DECEMBER 1994

APR 10 1995

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
COUNTY OF MECOSTA  
REGISTER OF DEEDS

or corners in

Mecosta

(County)

Located In:

Corner Code ##

Public Land Survey

T 16N R 9W

C-7

T R

T R

T R

T R

Property Controlling

S T R

in Section

S T R

Miscellaneous

S T R

Property in Sec.

S T R

'94 DEC 22 P1:26

Carl Waldron  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

Lot No. , Recorded Plat

Private Claims

Matthew McClung, in a field survey on December 11, 1994, hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	13		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Description of original monument and accessories and/or subsequent restoration:

The original corner was set by deputy surveyor Abner Van Ness on 26 March 1838. Volume 2, page 162 of Field Notes, set wood post.  
7" Elm S77E 18 lks.  
20" S. Maple S40W 10 lks.

Page 56 of county survey records by June. Dated 4-17th of 1899 Tile.


Surveyor Sours, 4-1919

6" Maple N47E 50.5 feet

20" Elm N14 1/2W 95.9 feet

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Set Mecosta County monument in monument box, 2.2' North of center line, in center line of road to North. Set Corner from witnesses in 1919 road survey. One tree was an Elm 20" N14 1/2W 95.9' which is now a rotten stump, and the other is O.B.T. below.

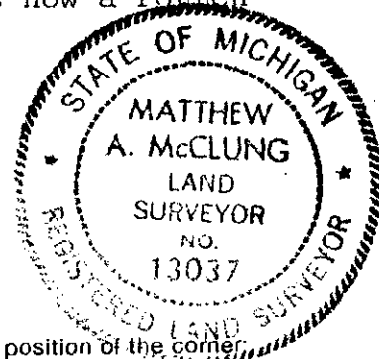

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner C-7. Mecosta County Monument, which is a 3" brass cap mounted on a 2 1/2" pipe, 36" in length, and is accepted as a careful reestablishment of the position of the original corner.

Fence Post N45W 42.7 feet

24" Maple N54E 50.23 Feet O.B.T.

Power Pole S38E 54.36 feet.

SW Corner of School House N70E 101.5 feet.

APPROVED BY MECOSTA CO. PEER GROUP  
IN ACCORDANCE WITH P.A. 345 of 1990

James J. Knapp  
CHAIRMAN  
DATE DEC. 12, 1994

igned by

Matthew A. McClung

Date December 11, 1994

urveyor's Michigan License No.

13037

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1993