

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Marguette (County)		Located In:			ln:	Corner Code //
1	Public Land Survey			1	fl	
				T	R	
				T	R	
				T .	R _	
2.	Property Controlling	S	5	T 43N	R 25W	1, 8, 12, 15
	in Section	s		T	R	
3.	Miscellaneous	S		T	R	
	Property in Sec.	S		T	R	

Register of Deeds Stamp & File Number

4. Lot No. . Recorded Plat


Private Claims

Paul Bressette

June 15

, in a field survey on do hereby certify that under requirements of P.A. 74. Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded

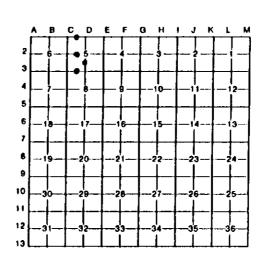

A. Description of original monument and accessories and/or subsequent restoration:

West one-sixteenth corner common to Sections 5 and 32. Not set in original survey, no evidence of subsequent establishment.

- West one-sixteenth corner of Section 5. 1974: 4-inch square concrete monument shown on Certificate of Survey by RLS 19616.
- 2 South one-sixteenth corner of Section 5. Not set in original survey. Found 1" iron pipe north about 10 feet.
- 5 West one-sixteenth corner common to Sections 5 and 8. Not set in original survey, no evidence of B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Corner position established mid-point and on-line between the Northwest and North guarter corners of Section 5. Corner falls on east edge of power line right-of-way.

- Found concrete monument as described. Accepted monument as corner as it falls 0.26 feet from calculated position.
- 2 Corner position established mid-point and on-line between the South Quarter and Center Quarter corners of Section 5. Corner falls in a field.
- 5 Corner position established mid-point and on-line between the Southwest and South Quarter Corners of Section 5.
 - C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

15 DNR Monument DNR Monument 8 4" 12 DNR Monument sq. concrete *4" W. Pine N75E 73.50' 6"Spruce N44E 41.45 N19°E 12" Spruce N81E 10.3 \$18W 293.86' 10"Y.Birch \$35E 8.3' S10°E 64.15' 12" W.Pine 9.21 NE Cor Log Camp W.Pine 538°W S56W 218.63' 14"Sugar S63W 20.25 34.551 NE Cor House 6" W.Pine S72W 96.71 N78^OW 23.5 N38W 11.05 Cedar Post North 0.7' 6"Sugar 82.0' 4" W.Pine N17W

*PK w/DNR reference tag

PAUL R BRESSETTE ONAJVd ber

R. Bressto Date

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND EURVEYORS, JAN. 28. 1971 REVISED MAY 14. 1975