

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Marquette

(County)

Located In:

Corner Code #

1. Public Land Survey

T 45N R 29W

J7

T R

T R

T R

2. Property Controlling
in Section

S 23

T 45N R 29W

1

S T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

Oct 22 2002

I, Stephan J. Szyszkoski, in a field survey on , 20 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(J7) Quarter corner common to Sections 14-23. 1956: Original position remonumented by Billy D. Buckler from W.Pine 08Ts. Set 1" pipe with 4" brass cap. New witnesses: 9" J.Pine S60W 83 links, 9" J.Pine S44E 43 links.

(1-Sec. 23) West 1/16 corner between Sections 14-23. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J7) Recovered the 1956 monument, in good condition, at record bearing from the remains of the Jack Pine N8Ts, now both dead. The J. Pine SW is down and the SE is standing. The distances to these N8Ts were transposed in the 1956 record: the Jack Pine SW was found at 43 links, and the SE at 83 links distant. Left the monument in place and made new witnesses as described below.

(1-Sec. 23) Established the corner midway and on a line of mean true bearing between Section corner 1332.21' West and Quarter corner 1332.21' East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J7) Found 1" ID I.pipe with 4" brass MI
Dept. of Conservation cap. Blazed and
scribed:

10" W.Birch N38E 35.3' 1/4S N8T"

5" Balsam S09W 31.2' do

11" J.Pine S77W 29.3' do

6" twin Maple N54W 20.9' do

Sq'd spruce post adjacent. Bearings are
magnetic. Distances are to notch in
lower blaze.

(1) Set 1" IDx32" I.Pipe with 4" alum.
MDNR cap driven to refusal 12" b.g. Made
firm with small rock mound. Blazed and
scribed:

12" R.Oak in clump N02E 2.4' 1/16S 8T"

6" R.Maple S73E 39.6' do

5" R.Pine S24W 37.6' do


12" R.Oak(twin) N88W 29.1' do

Set sq'd cedar post adjacent. Bearings
are magnetic. Distances to notch in
lower blaze.

Signed by Stephan J. Szyszkoski

Date 10/23/02

Surveyor's Michigan License No. 33986

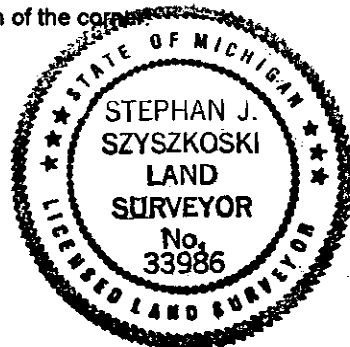

For the Michigan Department of Natural Resources - Office of Property Management

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

REVISED OCT., 1995