## SURVEY & REMONUMENTATION

FEB 21 2001

## SECTION

MARQUETTE

(County)

1. Public Land Survey

5. Private Claims

For corners in

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Corner Code #

G-13

MARQUE!	TE C	
RECEIVED	FOR	RECORD

7m	DEC	22	AM	In:	17
ZW	טבט	44	A19	10	1 1

Patricia	A.	Mone	lew
REGISTER	OF	DEEDS	Sur

	ТВ	<u> </u>	
	TR		
	TR		
. Property Controlling	S TR		
in Section	S T R		
3. Miscellaneous	S T R		LIBER R2 PAGE 277
Property in Sec.	S T R		FIREK TEC LUCK
• •			Register of Deeds Stamp & File Number
. Lot No , R	ecorded Plat		

GERALD W. CARLSON , in a field survey on November 13 th hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Located in:

T\_49N R\_26W

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration: G-13: Corner common to Sections 33 & 34, T49N-R26W. 1844: Austin Burt's original Township Line survey notes of T49N-R26W, describe the


corner monument as a wood post referenced by: 24" Hemlock

53 links North.

12" Sugar

N48W.

66 links

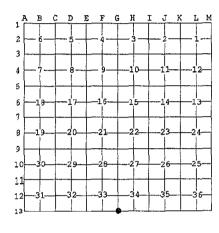

RATIFIED BY PEER GROUP P.A. 345 OF 1990 Jusque

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-13: 2000: SCA survey crews conducted a thorough search of the area and found no evidence of monumentation except a nearby tree with blue paint and East-West paint lines. The GLO line calls East and West checked reasonably well. Corner position was established on the latitudinal curve by single proportionate measurement between the Southeast Corner of Section 31, T49N-R26W and the Southeast Corner of Section 36, T49N-R26W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13: 2000: Set a 2 3/8" O.D. aluminum pipe capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is 0.6' above ground and rocks are placed around it. Referenced by:

9" Maple 5"

S05W, 20.91' N11W, 8.38' Maple

10" 12" Maple

Maple

\$85W, 3.42' N63E, 2.37'

Northeast Corner of Section 4, T48N-R26W N89°53'14"E, 15.19'

Green Steel Sign Post w/ Yellow Survey Marker Sign N15E, 3.54

Distance East 2638.37', distance West 2638.37'.

Note: Bearing trees have painted face, butt, and side nail blazes, d.h. measuring nails, and stamped B.T. Tags affixed.

Bk. 15, Pg. 79 T49N-R26W Corner Search Sheet 2000035



REVISED JAN., 1983 REVISED OCT., 1995

Signed by Livell	WCarlson	Date 12-19-00
Surveyor's Michigan License No	24589	FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971