

FEB 21 2004

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MARQUETTE
(County)

Located In:

Corner Code #

1. Public Land Survey

T 49N R 26W

I-13

2. Property Controlling in Section

S

I

3. Miscellaneous

5

T

Property in Sec.

5

T

4. Lot No. _____, Recorded Plat

5. Private Claims

I, GERALD W. CARLSON, in a field survey on December 4th, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-13: Corner common to Sections 34 & 35, T49N-R26W.

1844: Austin Burt's original Township Line survey notes of T49N-R26W, describe the corner monument as a wood post referenced by:

16"	Hemlock	N69E,	33 links	10"	Birch	N68W,	40 links
-----	---------	-------	----------	-----	-------	-------	----------

No subsequent record evidence recovered.

**RATIFIED BY PEER GROUP
P.A. 345 OF 1990**

DATE 11/6/00

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-13: 2000: SCA survey crews conducted a thorough search of the area and found no evidence of monumentation except a nearby Spruce tree painted blue. The GLO line calls East and West checked reasonably well. Corner position was established on the latitudinal curve by single proportionate measurement between the Southeast corner of Section 31, T49N-R26W and the Southeast corner of Section 36, T49N-R26W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1-13: 2000: Set a 2 3/8" O.D. aluminum pipe capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is 0.2' above ground. Referenced by:

16"	Black Spruce	N25E,	26.09'	9"	Twin Maple	S88E,	45.91'
-----	--------------	-------	--------	----	------------	-------	--------

8"	Twin Maple	\$17E,	27.27'	12"	Black Spruce	\$78W,	22.13'
----	------------	--------	--------	-----	--------------	--------	--------


NW Corner Section 2, T48N-R26W N89°52'19"E, 13.85'

Green Steel Sign Post w/ Yellow Survey Marker Sign	North	2.0'
--	-------	------

Distance East 2638.37', distance West 2638.37'.

Note: Bearing trees have painted face, butt, and side nail blazes, d.h. measuring nails, and stamped B.T. Tags affixed.

Bk. 16, Pg. 51 T49N-R26W Corner Search Sheet 2000035

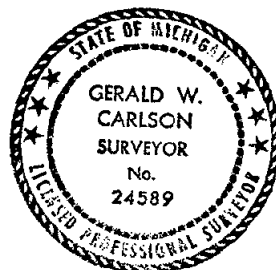

Signed by Harold Wilson

Date 12-19-00

Surveyor's Michigan License No. 24589

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995