

SURVEY &
REMONUMENTATION

APR 24 1995

1994 NEWAYGO COUNTY REMONUMENTATION PROJECT

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

VOL 001 PAGE 150

For corners in

Newaygo

(County)

Located In:

Corner Code ##

NEWAYGO COUNTY
REGISTER OF DEEDS
MARLENE TOOGOOD

'95 MAR 14 PM 4 00

Marlene Toogood

Register of Deeds Stamp & File Number

1. Public Land Survey T 16N R 14W A-2
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. Recorded Plat
5. Private Claims

I, Norman L. Ochs, in a field survey on February 25, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

W. 1/4 Corner, Section 6, Troy Twp., Newaygo Co., MI

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. Mullett, Brookfield 1837

Forest Service Plats

6" Birch S80°W 17 lks. (11.22') #1

"Water Wonderland" plats and surveys by Harry Kennitz in Sec. 1 (16-15)

10" Hemlock N48°W 30 lks. (19.80') #2

should probably be extended East to intersect the Twp. line to recover this corner location.

"Water Wonderland No. 2" Bernard Feldhauser R.L.S. #10685 April 24, 1978

Its position seems to agree with the information provided on the face of the plat, that is, it seems to lie on the extension of the East and West 1/4 line using the bearing and corner information provided by the plat map.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 2 1/2" O.D. Iron and a 1/2" Iron rod in two different locations. With the 2 1/2" Iron Pipe I also found a pine post with a U.S.F.S. location tag on it (not legible). I feel the 1/2" Iron Rod is the correct location for the original section corner because it fits best with the G.L.O. proration. I measured 2647.57 feet from the S.W. Cor. to the W. 1/4 Cor. of Sec. 6 and measured 2732.34 feet from the W. 1/4 Cor. to the N.W. Cor. of Sec. 6 and the condition of the recorded witnesses are: #1 and #2 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set a 4" dia. Harrison Cast Iron Monument 20" long marked "County Surveyor" on top of the 1/2" Iron Rod as a substantial marker for the section corner and is accepted as a careful and faithful reestablishment of the original corner.

2 1/2" O.D. Pipe N06°E 109.09'

18" Cedar N70°E 31.45' Nail in root

10" Cedar S75°E 56.64' Nail in root

3" W. Pine N65°W 56.64' Nail in root

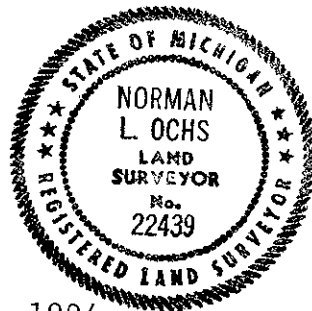

Signed by

Norman L. Ochs

#22439

Date

November 21, 1994

Surveyor's Michigan License No.

Approved by Peer Review Group on November 22, 1994

Norman L. Ochs, County Representative