

# REMONUMENTATION

APR 25 1995

## COMMISSION

For corners in

OTSEGO  
(County)

Located In:

Corner Code #

1. Public Land Survey

T 31 N R 2 W

M-5

2. Property Controlling  
in Section

S T R

3. Miscellaneous  
Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

### OTSEGO COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 ALSO Act 345, PA 1990

10004 PAGE 60

OTSEGO COUNTY  
RECEIVED FOR RECORD

94 DEC 29 PM 1:34

LYLE H. PRATT  
CLERK/REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Carl I. Robinson, in a field survey on April 18, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**


A. Description of original monument and accessories and/or subsequent restoration:

GLO 2/10: J. Mullett, 1840: Set Post-Sugar 16" S 52°W 15 lks (9.9'), Sugar 8" N 28°E 12 lks (7.9').  
CSR 1/107: D.M. Hoffman, 1907: Sugar 14" N 20°E 46 lks (30.4'), Sugar 14" N 20°E 46 lks (30.4'), Sugar 12" S 45°E 42 lks (27.7')-(Ed. First Sugar was GLO, therefore I assumed he found GLO Post).  
CSR 3/124: G.F. DeLaMater, 1938: 1/2"x36" bar in corner established on Twp. line between corners of which we were sure (A-4 & A-7)-Large Stone N 89°E 51.8', Concrete Monument S 37°W 50.2', Triple W. Birch 4" S 88°W 5.9'. G.F. DeLaMater, 1940: Found 100' error in 1938 work and adjusted corner to new position.  
LCRC 2/143: G.R. McKelvey, 1979: Found 1/2" Iron Rod, W. Birch & Concrete Monument witnesses, set Otsego County Monument-1/2" Iron Rod S 08°E 74.61', spk 9" Aspen N 37°E 41.09', spk 12" W. Birch S 88°W 5.66', Concrete Monument S 37°W 50.12'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Otsego County Monument and all of McKelvey's witnesses which include DeLaMater's Concrete Monument & triple W. Birch. DeLaMater Proportioned this corner between A-4 & A-7, I find it fits this proportion within one foot.

C. Description of monument for corner and accessones established to perpetuate locating the position of the corner:  
Otsego County Monument-spk 11" Aspen N 37°E 41.09', 1/2" Iron Rod S 08°E 74.61', Concrete Monument S 37°W 50.12', spk 12" Tri W. Birch S 88°W 5.66'. This corner is accepted as a careful and faithful reestablishment of the position of the the original corner.

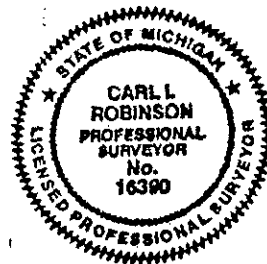

OTSEGO COUNTY REMONUMENTATION

Approved by the County Survey Peer  
Group, pursuant to Act 345, PA 1990.

12/22/94  
Date

V. Chairman

Signed by Carl I. Robinson, PE & PS, Otsego County Surveyor  
Surveyor's Michigan License No. 16390

Date November 15, 1994

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983