

# SURVEY & REMONUMENTATION

APR 05 1996

COMMISSION

## OTTAWA COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ottawa

(County)

Located In:  
Wright Twp

Corner Code #

1. Public Land Survey

T 8N R 13W

F-9

T R

N $\frac{1}{4}$  corner

T R

Section 28

T R

2. Property Controlling  
in Section

S T R

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

RECORDED

95 NOV 29 PM 1:46

*Edythe K. Kellman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Carl P. Englert, Jr., in a field survey on October 31, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

F-9

1/4 corner common to sections 21 & 28

Original corner set September 1838

by Enock Hammete

A Sugar 12" for 1/4 section corner.

LCRC Liber 1, Page 811 12/7/1972

Found "T" Iron

16" B. Oak NNE 29.22'

Iron N. 33.00'

24" Maple ESE 92.69'

P.Pole S. 30.76'

see other side

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

F-9

1/4 corner common to sections 21 & 28

Found 4" CIM with Broken Top in Mon. Box on CL of Asphalt Road

Found P.P. S. 30.76'

Found P.P. N. 84.56'

PA. 345 OTTAWA COUNTY

PEER APPROVED 11-20-95

*YDY Rodney D. Nedwell*

Accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-9

1/4 Corner common to Section 21 & 28

4" CIM with Broken Top in Monument Box

Ottawa County Remonumentation Tag and Nail in W. side P.P. N 01° E 84.46'

Ottawa County Remonumentation Tag and Nail in NE side 10" Oak N 37° W 78.33'

Ottawa County Remonumentation Tag and Nail in W. side 12" Tw. Oak S 8° W 30.12'

Ottawa County Remonumentation TAG and Nail in E. side P.P. S. 07° E 30.71'

Ottawa County Remonumentation Tag and Nail in S. side P.P. N. 75° E 346.69'

Signed by


*Carl P. Englert Jr.*

Surveyor's Michigan License No.

18987

Date

11/10/1995

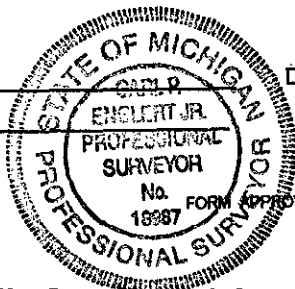

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995

F-9 T 8 N, R 13 W

LCRC Liber 3, Page 15

Found iron monument per old witnesses.

Nail in P. Pole S. 30.73'

Nail in P. Pole N. 84.56'

Nail in 9" Elm SE 122.15'

LCRC Liber 3, Page 56

Found "T" Iron, set cast iron monument  
12" Elm, SE 122.15'

P. Pole S. 30.73'

P. Pole N. 84.56'

\$ 11.00 CORNER