

JUDITH D. ROEHM
Ontonagon County
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Ontonagon County Remonumentation Corner

1P

5/178

LC
Rec. Date 12/29/98 Time 16:20

RECORDING FEE:

9.00

For corners in

Ontonagon County Located in: Corner Code #

1. Public Land Survey T51N R39W M-11
T51N R38W A-11

2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

SURVEY &
REMONUMENTATION

MAR 10 1999

SECTION

Register of Deeds Stamp & File Number

I, Joseph C. Domitrovich, in a field survey on December 8, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
(M-11) Corner Common to Section 25 & 36, T51N, R39W and Section 30 & 31, T51N, R38W

1845 - Austin Burt set a Lynn post
22" Sugar N 26° E 44 links
16" Hemlock N 45° W 11 links

1846 - Hiram and Sylvester Higgins added one bearing tree:
10" Ironwood S 45° E 22 links

I found no subsequent Records

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I found a 1" mushroomed iron pipe at the intersection of old fallen fences to the South and West and an old blazed line to the East. This pipe works well with other corners to the West and South and distant North.

I have accepted it as the Section Corner.

Research on file with County Remonumentation Representative.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" x 48" iron pin with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T.51N, R.39W, R.38W; S.25, S.36, S.30, S.31; 1998; P.S. 37273. The corner falls 10 feet west of a new sheep fence (fence wanders from tree to tree in an Easterly and Southerly direction).

Witnesses:

11" Balsam	N 36° E	32.93'
4" Hard Maple	S 44° E	2.89'
5" Soft Maple	S 15° W	9.03'
7" Balsam	N 65° W	25.43'
Steel Sign Post	North	1.31' (to face)
N ¼ Cor. Section 36	S 89°40'14" W	2640.88'
E ¼ Cor. Section 36	S 00° 15'10" E	2633.27'

DEED GROUP REPRESENTATIVE
Earl W. Applekamp
COUNTY CLERK
12-18-98

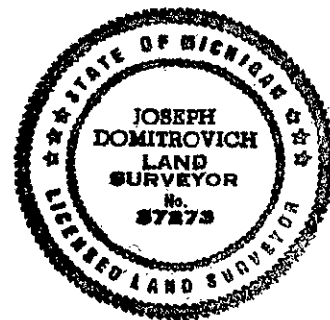

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by J. C. Domitrovich

Date 12-18-98

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995