

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

Ontonagon County

Page 1 of 1

LC 5/306

DATE 07/10/2000

Time 12:13:25

RECORDING FEE:

9.00

For corners in

Ontonagon County	Located in:	Corner Code #
1. Public Land Survey	T51N R39W	H - 1
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No.	Recorded Plat	
5. Private Claims		

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION  
Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Joseph C. Domitrovich, in a field survey on June 20, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(H - 1) North 1/4 Corner Section 3, T51N, R39W. \* Note: This corner is not common with 1/4 corner in Section to <sup>North</sup> South.

This corner was not set in the original survey but was protracted midway between NW & NE corners of Section 3 (closing corners) for acreage calculations.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found no evidence of any kind at this corner position. I established a position for this corner midway between closing corners and on line between the SE corner and S 1/4 corner of Section 34, T52N, R39W. The corner now falls on the Northernly edge of a power line clearing and at the southerly edge of a clear-cut.


Research on file with County Remonumentation Representative.

NEED GROUP APPROVAL  
*Carl W Applekamp*  
COUNTY CLERK 6-21-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1/2" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R39W; 1/4; S. 3; S.C.; 2000; P.S. 37273. Ties:

4" Balsam	N 38°E	12.51'
Northerly Power Pole	S 80°E	256.65'
Steel Sign Rail	South	0.51' (to face)
20" Basswood	S 31°W	117.87'
Southerly Power Pole	S 80°W	349.58'
S 1/4 Cor. Sec. 34 T52N, R39W	S 89°54'20"W	43.56'
SE Cor. Sec. 34, T52N, R39W	N 89°54'20"E	2599.71'
NE Cor. Sec. 3,	N 89°53'51"E	2660.42'
NW Cor. Sec. 3	S 89°54'36"W	2660.42'

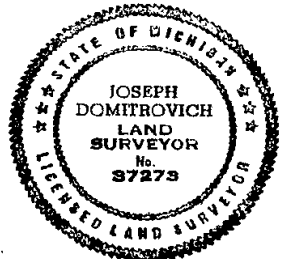

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by *J. C. Domitrovich*

Date *6/21/00*

Surveyor's Michigan License No. 37273