

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Ontonagon County
Page 1 of 1
JEN Date 07/10/2000 Time 12:13:33
RECORDING FEE: 9.00

For corners in

Ontonagon County	Located in:	Corner Code #
1. Public Land Survey	T51N R39W	J - 1
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No.		Recorded Plat
5. Private Claims		

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Joseph C. Domitrovich, in a field survey on June 19, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(J - 1) North 1/4 Corner Section 2, T51N, R39W. * Note - This corner is not common with 1/4 corner in Section to North.

This Corner was not set in the original survey, but was protracted, for acreage calculations, midway between the NW & NE corners of Section 2. (Closing Corners)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I established the corner midway between closing corners to the East and West and on line between the S 1/4 corner & SE corner of Section 35, (T52N R39W). This corner falls 41.57' East of the S 1/4 corner of Section 35. It also falls 40' East of a blue painted line to the North & South. The forester who marked the timber in this area mistakenly treated the South 1/4 corner of Section 35 as being common with this corner.


Research on file with County Remonumentation Representative.

DEER GROUP APPROVED
Earl W Applebaum
COUNTY REGISTERED 6-21-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 48" aluminum rod with a 3" diameter cap stamped to read: COUNTY REMONUMENTATION; T51N, R39W; 1/4; S. 2; C.C.; 2000; P.S. 37273. Corner falls at the Northerly Edge of a power line clearing. Ties:

7" Soft Maple	N 35°W	15.83'
4" Balsam	N 14°E	4.64'
9" Soft Maple	N 58°E	17.16'
Sign Rail	South	0.57'
S 1/4 Cor. Sec. 35 (T52N, R39W)	S 89°52'46"W	41.57'
NW Cor. Sec. 2 (Closing Cor.)	S 89°33'13"W	2604.55'
NE Cor. Sec. 2 (Closing Cor.)	N 89°52'48"E	2604.55'

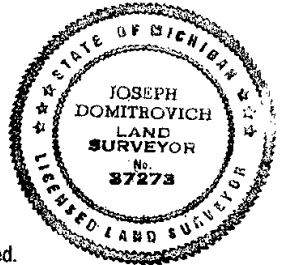

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by *J. C. Domitrovich*

Date *6/21/00*

Surveyor's Michigan License No. 37273