
AND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Presque Isle	Located In			Corner Code #	
(County)					
1. Public Land Survey		T	36N 36N	R 2E R 2E	C-7 C-8
2. Property Controlling in Section	s	T		RR	
Miscellaneous Property in Section	s	T		R R	
4. Lot No:	Recorded Plat:				
5. Private Claims:					
I, Carl T. Kiiskila, in a field survey on August 5, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1					

Register of Deeds Stamp & File Number

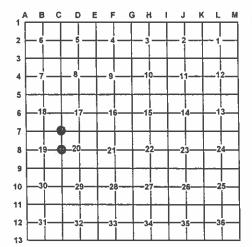

and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- C-7 Section Corner comm. to sec.'s 17,18,19 & 20, T36N,R2E

1856 - GLO - George H. Cannon - Set post corner of sections 17,18, 19 & 20.

Y.Pine 14" S28°W 64 links Y.Pine 18" N38°E 102 links

1926 - "1926 Survey" in DNR copy GLO book - pg. 63 - C.M. Cade -

16"Y.Pine on knoll S15°W 237 links; 7"J.Pine N10°W 154 links. 1978 – L.C.R.C.#351 – Delmer E. Porter, P.S.#15410 – Fd. 2" pipe at rd. Intersection. Reset position with 4"conc. Mon. with brass cap. N36°E 49.17' 20" twin Oak; S24°E 28.79' 6" N.Pine; S58°W 27.52' 4" Maple

1994 - L.C.R.C - L.311, p.120 - Norman J. Quaine, P.S.#33984 -Found conc. Mon. per Porter. S60°W 41.92' 11" R.Pine; N39°W 47.51' 7" Maple; N36°E 49.32'

20" Twin Oak; N74°E 42.48' 6" Jack Pine

C-8 1/4 Corner comm. to sec. s 19 & 20, T36N,R2E

1856 - GLO - George H. Cannon - Set quarter section post. W.Pine 22" N64°W 27 links Y.Pine 18" S51°E 86 links

1994 - Remon L.C.R.C - L.311, p.121 - Norman J. Quaine, P.S.#33984 -Found no evidence indicating corner's position. Set ½" rod &

cap#15410 by single proportion. N13°E 79.84' 18" W.Pine S41°E 31.06' 12" N.Pine S13°E 31.74' 12" N.Pine S40°W 77.46' 10" Oak

- B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:
- C-7 Section Corner comm. to sec.'s 17,18,19 & 20, T36N,R2E

C-8 1/4 Corner comm. to sec.'s 19 & 20, T36N,R2E

Found 4" conc. Mon. with 3" brass cap down 0.3' below grade in trail roads intersection per L.C.R.C.#351. Accepted found conc. Mon. as the best available evidence for the position of the original corner. Found no other evidence to dispute the location for the corner.

Found "T" iron (24" long) with DeLaMater & Muschell washer on it. Also

found badly bent ½" rebar 0.2' SSE of "T" iron. Corner falls 3' East on C/L N-S trail road. Accepted found "T" as the best available evidence for the position of the original corner. Replaced 24" long "T" iron w/ standard DNR monument 1' below grade. Found no other evidence to dispute the location for the corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- C-7 Section Corner comm. to sec.'s 17.18.19 & 20, T36N,R2E

C-8 1/4 Corner comm. to sec.'s 19 & 20, T36N,R2E

Stamped 4"dia. Alum cap on 1"x36" galvanized pipe.

Fd. 4" dia. Conc. Mon. with 3" dia. stamped brass cap.

*N36°E 49.07' to set N&T at old N&T on NW side 18" R.Oak *N72°E 42.35' to set N&T at old N&T on N side 9" J.Pine S25°W 65.64' to set N&T on E side 13" R.Oak *N40°W 47.25' to set N&T at old N&T on E side 10" R.Maple

* Previous recorded witness.

*N13°E 79.12' to set N&T on W side 30" W.Pine *S36°E 31.06' to set N&T on W side 20" R.Pine *\$10°E 32.00' to set N&T on E side 17" R.Pine *\$44°W 77.57' to set N&T on NW side 17" R.Oak N17°W 46.76' to set N&T on NE side 4" R.Pine

* Previous recorded witness.

Surveyor's Michigan License No.:

33981

SINTE OF MICHIGAN **K**iiskila LAND SURVEYOR "ICENS" No.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYOR DAS 28 1971
Revised Jan. 1983

Revised Oct. 1995