

**1997 REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE**
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in: **ELLINGTON TWP.**

<u>TUSCOLA</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>13N</u> R <u>10E</u>	<u>J-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, JONATHAN M. FIELD, in a field survey on JULY 24 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
1834 GLO; PARKE, D.S.; SET 1/4 SEC. POST; CEDAR 14 N48E 14LKS., W. ASH 10 N31W 25LKS.
1974 KAY ENG. CO.; KAY, P.S.#14096; SURVEY L.442 PG.720-721; NO OBJECT STATED; S70E 42.90' COR POST, N35W 29.67' 8" ASPEN, N50E 30.32' 6" ELM

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
1997 ROWE; FIELD, PS#37276; FND. 1/2" ROD; RECOVERED 2 PREVIOUS WITNESSES WHICH INDICATE THAT FND. ROD IS IN SAME POSITION AS 1974 KAY SURVEY CITED IN SECTION A. ABOVE

ACCEPTED FND. ROD AS THE BEST AVAILABLE EVIDENCE OF THE ORIGINAL CORNER POSITION


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
J-13 REPLACED FND. ROD W/ STD. REMON. MONUMENT STAMPED J-13 T13N-R10E EAST, 27.79' FND. 1/2" ROD APPARENT J-1 T12N-R10E
S60°E, 43.32' SET P-K NAIL W/TAG #37276 IN NE FACE FENCE COR. POST
S56°W, 31.67' SET NAIL W/TAG #37276 IN NW FACE 10" POPLAR
N03°W, 26.04' SET NAIL W/TAG #37276 IN W. FACE 10" POPLAR
N58°E, 31.87' SET NAIL W/TAG #37276 IN SE FACE QUAD 4" ELM
N67°E, 87.82' SET NAIL W/TAG #37276 IN NW FACE 18" ASH
N06°E, 23.26' FND. NAIL W/FLAG. IN S. FACE 4X4 POST

RECEIVED FOR RECORD
LIBER NO. _____ PAGE NO. _____
FILE NO. 46
ELLINGTON TOWNSHIP
97 OCT -7 PM 3:03
TUSCOLA COUNTY
REGISTERED DEEDS

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

Signed by Jonathan M. Field Date 9-24-97
Surveyor's Michigan License No. 37276

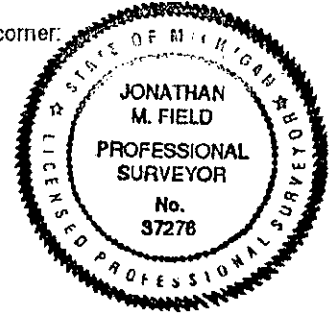

APPROVED
9-22-97

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN, 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983

SURVEY &
REMONUMENTATION
NOV 26 1997
COMMISSION

