

RC 1234

# LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

LI 27015 PA 709

For corners in

Wayne

(County)

Located In:

Corner Code #

1. Public Land Survey T 1S. R 10E. A-5  
T R  
T R  
T R
2. Property Controlling S T R  
in Section S T R
3. Miscellaneous S T R  
Property in Sec. S T R

Compliance with  
ACT 345, P.A. 1990

APPROVED ON: 12-7-93  
WAYNE COUNTY REMONUMENTATION  
PEER GROUP COMMITTEE

Register of Deeds Stamp &amp; File Number

4. Lot No. , Recorded Plat  
5. Private Claims

I, William L. Roskelly in a field survey on October 27, 19 93,  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the  
current manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5  
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a  
Court of Law; established, re-established, monumented, re-monumented, recovered, found as  
expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded  
on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration: No G.L.O. Witnesses remain  
Jos. Fletcher G.L.O. set cor. post Oct. 16, 1816 Witnesses: Beech 10S 78W 11 Do 12N 52W 29  
L.C.R.C. L.19980 P.204 & 205 on November 22, 1977 Richard W. Swanson found a concrete  
monument in box and set the following witnesses:  
N.W. 71.62 ft. to nail with brass tag in S.W. side of D.E. pole.  
N.E. 71.83 ft. to nail with brass tag in S.E. side of D.E. pole.  
S.E. 70.80 ft. to P.K. nil in S.W. Side of D.E. pole.  
S. 40.64 ft. to concrete monument in box.  
S.W. 98.34 ft. to center of N.E. bolt of Shell Oil sign base.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
Found steel bar in concrete monument in monument box at Six Mile Road  
and Inkster Road.  
Also verified section corner thru document L.19980, P.204, 205  
N.W. 71.62 Tag S.W. face P. Pole meas. 71.54  
N.E. 71.83 Tag S.E. face P. Pole meas. 71.79  
South 40.64 conc. mon. in box meas. 40.70

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
A-5: Section corner 7 & 18 T.1 S., R.10E., Found steel bar in concrete monument  
in monument box. The selected location is accepted by the Contractor and is generally  
accepted by professional surveyors as the best available evidence of the position of the  
original corner. Placed Wayne Co. brass disk with license #10705.

1. Found WCRC Tag & double head nail S.E. face P. Pole N. 50° E. dist. 71.79  
2. Set WCR Tag & nail N.E. face P. Pole S. 30° E. dist. 70.50  
3. Mon. box conc. mon. iron pipe due South dist. 40.70  
assumed to be N.E. corner Section 13, T.1 S., R.9E. Livonia  
4. Set WCR Tag & nail N.W. face light pole S. 40° W. dist. 94.20  
5. Found WCRC Tag S.W. face signal pole N. 36° W. dist. 71.54

Signed by


Date

November 9, 1993

Surveyor's Michigan License No.

10705

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

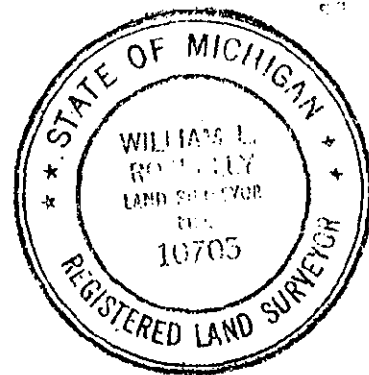

2R  
11K1