

MAR 31 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED

DEC 29 AM 9:40

For corners in

Wexford
(County)

Located In:

Corner Code #

Linda Longmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

- | | | |
|------------------------------------|------------|------|
| 1. Public Land Survey | T 21N R 9W | M-12 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Richard Wilcox, in a field survey on November 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-12) 1838 GLO Quarter Section post by John Brink, Deputy Surveyor, Hemlock 11" S 14° W 20, Beech 10" N 80 1/2° W 24
M-12) 1901 D. Teed survey: Set on transit line from Northeast corner of Section 36 and Southeast corner of Section 36 and 1/2 distance. Delmar E. Teed Survey stake is 3/4 link South & 2 links West of Richardson's stake: Government witnesses all gone.
M-12) 1985 Granger survey, Liber 2, page 156, S 85° E Power pole 31.35, N 20° W clump 10" Box Elder 21.55, S 30° E Gate post 69.15 - no description of monument

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- M-12) 1/4 Section corner common to Sections 36 and 31, T21N, R8W
Found Wexford Co. monument in very good condition ±8.5' West of the centerline of the trail S 05° W and N 01° E, ±3.3' North of fence line running S 86° E and ±35.6' West of corner fence post. Looked for old stake of Richardson's, described by Teed Sept. 1, 1899 and found nothing.


Peer Group Reviewed and Approved

Date: 11-29-93
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-12) Wexford County monument, left in place

- S 84° E - 31.29 - Power Pole
S 27° E - 140.22 - 16" Maple
N 25° W - 21.60 - 12" Box Elder in clump
S 11° W - 61.17 - 4" Cherry

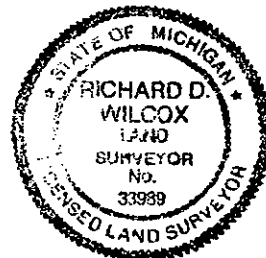

Signed by Richard D. Wilcox Date 11/29/93

Surveyor's Michigan License No. 33989