

Part B: Surveyor's Report on Perpetuation or Monumentation of Corner(s)

C-7, Being the corner common to Sections 17, 18, 19 and 20, T22N, R12W.

Found 1/2" x 18" iron 16" below surface per RAG witnesses, wood fiber and one piece of crockery. No other evidence. Witnesses 1-5 gone. Found 1/2" iron fits GLO calls to swamp East and South and stream South and is in center of intersection, roads to North, East and West. Iron is accepted as the best available evidence of the position of the original corner.

Distance to D-7, 2639.26'-Gnd; 2619.54'-GLO

Distance to C-8, 2644.05'-Gnd; 2640.00'-GLO; 2648.58'-AJT

Removed 1/2" iron and set 5/8" x 36" iron with Wexford County brass cap stamped 2016, 17, 18, 19 & 20, JAR, 25869

Part C: Field Evidence of Perpetuation or Monumentation of Corner(s)

C-7, Being the corner common to Sections 17, 18, 19 and 20, T22N, R12W.

Set 5/8" x 36" iron with Wexford County brass cap stamped 2016, 17, 18, 19 & 20, JAR, 25869

N35°E 31.73' 18" Maple (6)

S07°W 23.41' 16" Maple (7)

S61°W 31.52' 14" Birch (8)

N59°W 40.52' 13" Hemlock

Date of Observation	Latitude	Longitude	Datum and Adjustment Year	Epoch Date
August 24, 2016	N 44°17'41.42"	W 85°48'03.20"	NAD83 (2011)	2010.00

Method: GPS Network real-time position survey to MDOT CORS.

Disclaimer: The Latitude and Longitude reported hereon was observed using global positioning methods with an estimated positional accuracy of 1 foot, more or less, reported at time of observation. The reported Latitude and Longitude is a navigational accessory to the approximate corner location and shall not be used to reestablish the corner position or used in establishing property boundaries.


I, James A. Ray, in a field survey on August 24, 2016, certify under the requirements of the State Survey and Remonumentation Act, 1990 PA 345, MCL 54.261 to 54.279, and the Corner Recordation Act, 1970 PA 74, MCL 54.201 to 54.210d, that the corner(s) identified and described hereon has been perpetuated or monumented as described in Parts A, B, and C above, pursuant to the laws and rules of the State of Michigan.

James A. Ray

Professional Surveyor's License No.: 25869

Axin Land Surveys, Inc., 811 Sunnyside Drive, Cadillac, MI 49601

Date: 10/03/2016

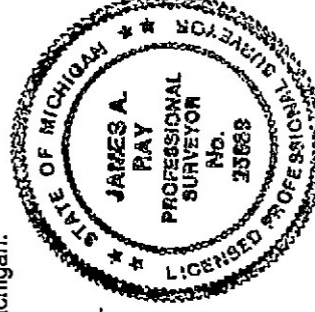

I, Craig J. Pullen, state that the corner(s) identified and described hereon and perpetuated or monumented as described in Parts A, B, and C above was presented to and reviewed by the Peer Review Group on 10-21-16, 2016 and is accepted for filing in the Wexford County Remonumentation Program.

Craig J. Pullen

Professional Surveyor's License No.: 39095

Date

11-25-16