


LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> ^{N.} XX R. <u>26</u> ^{W.} XX	<u>K-5</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ ^{N.} XX S. _____ ^{W.} XX R. _____ ^{E.} XX W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} XX S. _____ ^{W.} XX R. _____ ^{E.} XX W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

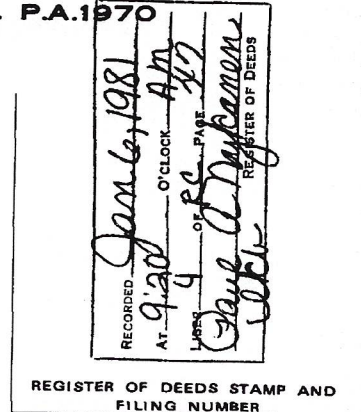

I, Robert E. Schmeling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 22, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to Sections 11, 12, 13 and 14, T42N, R26W, Marquette County.

Original Bearing Trees:

Tamarack 10" S44°W 25 (old stump with lower face evident this date. Charles Walkner observed iron marks within face on his visit in 1968.)
Cedar 12" N39°E 10 (now a moss covered mound).

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Observed above original evidence and found in place a 1½" x 2' iron bar below ground surface. Found old 3" squared cedar post 1½ feet south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced above iron bar with a 1" diameter 4' long galvanized iron pipe with brass cap thereon stamped with appropriate identification and left 3" cedar post in place. Made new witnesses as follows:

White Cedar	6"	N58°E	24.0 feet to	tree	(Scribed: S12 T42N R26W NBT)
Tamarack	5"	S41°E	21.2 feet to	tree	(Scribed: S13 T42N R26W NBT)
White Cedar	5"	S22°W	23.7 feet to	tree	(Scribed: S14 T42N R26W NBT)
Tamarack	5"	N71°W	13.0 feet to	tree	(Scribed: S11 T42N R26W NBT)

All bearings magnetic. Assisted by Charles Walkner and James Okraszewski.

SIGNED BY Robert E. Schmeling DATE May 22, 1980

SURVEYOR'S MICHIGAN REGISTRATION NO. 8317

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

