

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Commission

Allegan (County)

Located In:

Corner Code #

1. Public Land Survey T 4N R 15W C-1 (NW 1/4 Sec 5)
T R Fillmore Twp.
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

Sec. #1

Register of Deeds Stamp & File Number

1993 DEC 30 PM 2:41
REGISTER OF DEEDS
ALLEGAN COUNTY, MICHIGAN
Jasper A. Roberts

FILED

4. Lot No. , Recorded Plat
5. Private Claims

I, David R. Greer, in a field survey on December 13, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate. Government Notes 1831 Post
Ironwood 5" S46°E 10 links
Beech S23°W 23 links

A. Description of original monument and accessories and/or subsequent restoration:

C-1

Recorded in Liber 1, Page 134, Oct. 28, 1971

CL Manhole S45°W 34.00'
CL Mon. Box N85°E 5.40'

Recorded in Liber 2, Page 45, Nov 21, 1972

MSTD Nail in Power Pole ENE 73.38'
Traffic Light Guy Pole SW 39.17'
Telephone Pole SE 68.33'
Iron in Mon. Box ENE 5.28'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-1


Found 3/4" rod in monument box 0.91 South of the South line of Section 31, T5N, R15W, which fits the above witnesses. Set A.C. Remonumentation iron and cap on South line of Section 31, T5N, R15W 0.91 North of the closing corner and accepted it as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-1 A.C. Remon iron & cap on S line, Sec 31, T5N, R15W. AZ - Michigan State Grid Direction

Found rod in mon. box AZ. 179°41'10" 0.91'
A.C. remon C13, SW Cor, Sec 32, T5N R15W AZ. 90°42'49" 5.22'
NE Cor Brick Building AZ. 236°57'18" 77.17' SE Cor Bldg AZ. 59°00'07" 191.76'
SE Cor Brick Building AZ. 213°57'10" 128.26' CL Steel Pole AZ. 337°05'57" 40.20'
NW Cor Brick Foundation AZ. 114°42'58" 148.39'
NE Cor Building, Foundation AZ. 107°48'07" 198.32'
SW Cor Building, Foundation AZ. 137°14'14" 190.65'
Fnd Nail & Tag N Side Power Pole AZ. 70°40'45" 7.01'
O.C. remon nail & tag E Side 30" Maple AZ. 343°00'48" 70.52'

Signed by David R. Greer Date 12/13/93
Surveyor's Michigan License No. 16042

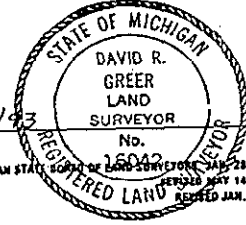

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
ADOPTED JAN., 1983

W:\Deeds\Surv\Remon.doc