

SURVEY & REMONUMENTATION

ALLEGAN COUNTY REMONUMENTATION
APR 07 1998 LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Allegan (County)

SECTION

Located In:

Corner Code #

1. Public Land Survey

T4N R15W

K-1

T R

Northeast corner

T R

Section 2

T R

Fillmore Township

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No.

Recorded Plat

5. Private Claims

I, Steve Lampen, in a field survey on December 6, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-1

G.L.O. - 1832 - Britain

78.33 to North boundary 100 links

West of post and set post corner

Sections 1 and 2

Beech 15 S 46 W 54

Sugar 5 S 19 E 5

K-1 - Gardner - 1879

Stone

K-1 - L-1 = 40.58 ch. = 2678.28

K-1 - K-2 = 37.93 ch. = 2503.38

K-1 - MSHD - 1965

Set iron

K-1 - K-13 Town 5 North, Range 15 West = 66.00

K-1 - K-2 = 2509.60

K-1 - J-1 = 2668.93

K-1 Van Order - 1993 - found pipe

25" Catalpa South Southeast 60.41

Power pole East Southeast 70.34

Ottawa Monument in monument box East 65.98

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-1 Found iron pipe

Power pole East Southeast 70.34

25" Catalpa South Southeast 60.41

Ottawa monument East 65.98

K-1 - L-1 measure 2684.34

K-1 - K-2 measure 2509.96

K-1 - J-1 measure 2668.91

Found iron pipe on South line of Section 35, Town 5 North, Range 15 West, and replaced it with an Allegan County Remonumentation iron and cap and is accepted as a careful and faithful perpetuation of the position of the original corner.

Approved by the Allegan County Remonumentation Peer Group on December 9, 1997.

Traversed 2646' on road.

APPROVED REMONUMENTATION CORNER

P.A. 345 OF 1990

ALLEGAN COUNTY

DATE APPROVED 12-9-97

COUNTY REP. K.V.O.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-1 Allegan County Remonumentation iron and cap on the South line of Section 35, Town 5 North, Range 15 West
Azimuths = Michigan State Plane grid direction.

Allegan County Remonumentation tag in South side power pole

112° 08'

70.32'

Allegan County Remonumentation tag in Northwest side power pole

52° 42'

142.38'

Northwest corner concrete bridge abutment

107° 19'

145.86'

Southwest corner concrete bridge abutment

80° 20'

220.45'

Centerline East and West asphalt road


180°

0.50'

K-13, Town 5 North, Range 15 West = cast iron monument

90° 47'

65.99'

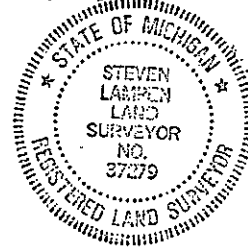

Signed by Steven Lampen

Date DECEMBER 12, 1997

Surveyor's Michigan License No. 37279

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1976
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

1100006 PAGE 089