
## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Baraga (County)	Located In:	Corner Code #
1. Public Land Survey	T R R	
<ul><li>2. Property Controlling in Section</li><li>3. Miscellaneous</li></ul>	S 2 T 48N R 33W S T R S 2 T 48N R 33W S T R	J2 (GCDB 540640) 12
Property in Sec.	s	(GCDB 540620)
4. Lot No. Reco	orded Plat	

Register of Deeds Stamp & File Number

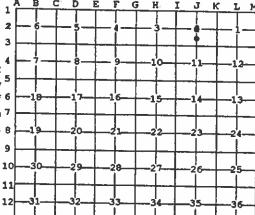

I, Stephan J. Szyszkoski, in a field survey on 12/14/15 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey 5 instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of 6 a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with 7 the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, 8 re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- (J2) Center of Section 2. Not previously monumented.

STEPHAN J. SZYSZKOSKI LAND SURVEYOR No. 33986

(12-Sec. 2) Center-South 1/16 corner, Section 2. Not previously monumented.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- (J2) Established the position for the corner at the intersection of straight lines connecting opposite 1/4 corners.
- (12-Sec. 2) Established the position for the corner midway and on a straight line between Center of Section 1317.84' north and Quarter corner 1317.84' south.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J2) Set 1"IDx28" I.pipe with 2" alum. MDNR cap. (12) Set 1"IDx28" I.pipe with 2" alum. MDNR cap. Set measuring nail with MDNR tag in the side of: Set measuring nail with MDNR tag in the side of: 14" Cedar N53°E 24.95' mrkd "C1/4 BT" 3" Sugar N26°E 7.8' mrkd "1/16S BT" 12" Sugar S84°E 31.7' do 9" Sugar \$34°E 5.95' do 10" Maple S08°E 16.5' do 4" Sugar N53°W 4.2' ďо 4" Maple in clump N82°W 9.35 do 7" Cedar N14°W 19.5' do Set sq'd spruce post adjacent. Set sq'd cedar post adjacent. E= 7892935.529 N= 201306.539 E= 7892925.834 N= 200905.045

Bearings are magnetic. Coordinates are MCS83 in meters, NAD83(2011) Epoch 2010.00 datum.

Coord. Ref.=NGS PID D08499: N= 221257.626 m. E= 7884435.168 m.

Signed by Stubbule Supplied Date 01/05/2016
Surveyor's Michigan License No. 33986

Revised Jan., 1983 Revised Oct., 1995