

SURVEY &
REMONUMENTATION

FEB 08 1999

SECTION

BRANCH COUNTY REMONUMENTATION CORNER
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

BRANCH

(County)

Located In:

Corner Code ##

GILEAD TOWNSHIP

1. Public Land Survey

T 8 S R 7 W

G - 03

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

STATE OF MICHIGAN
Branch County
Recorded

11-04-1998 15:49:21

Linda Lee Morrison-Mathews
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

GILEAD TOWNSHIP

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, EDWARD R. REED, P.S., for a field survey on JUNE 1, 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

CORNER COMMON TO SECTIONS 3, 4, 9 & 10, T8S, R7W, GILEAD TOWNSHIP.

1828: G.L.O., ROBERT CLARK, JR., D.S.: "SET POST COR SECS 3, 4, 9, 10.W.OAK 10 N31W 10, W OAK 6 N65E 60".

1881: C. HAMILTON, CO. SURVEYOR: "FD ORIGINAL STAKE HOLE, STUMP OF WITNESS TREE & ROOT OF ANOTHER. PLANTED PIECE OF SLEIGH SHOE WITH EARTHEN & TIN AS DEPOSIT".

1984: L. GERSCHBACHER, RLS #18990: "FD. 1/2" BAR 16" BELOW GRADE. RAISED WITH 1/2"X18" RE-BAR PLUMBED OVER CENTER". L.C.R.C. NO. 2/072.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I FOUND THE 1/2"X18" RE-BAR AS SET BY L. GERSCHBACHER IN 1984 AND RECORDED IN L.C.R.C. NO. 2/072.

SET A 1/2" REBAR WITH BRANCH COUNTY REMONUMENTATION CAP, IN CONCRETE, IN C-I MONUMENT BOX, AT LOCATION MARKED BY GERSCHBACHER'S IRON STAKE. TOP OF BOX IS ABOUT 4" BELOW ROAD SURFACE.

Liber 000003 Page 0238

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1/2" REBAR WITH REMONUMENTATION CAP, IN CONCRETE, IN C-I MONUMENT BOX:

SPK. IN 20" CHERRY S45E 34.53'


SPK. IN FENCE POST N45W 35.84'

SPK. IN 14" OAK N12E 133.43'

NE CORNER @ TOP OF SQ. TELEPHONE PEDESTAL S36W 41.40'

ACCEPTED BY THE BRANCH COUNTY
SURVEY PEER GROUP AS THE OFFICIAL
CORNER UNDER MICHIGAN PUBLIC ACT 345
OF 1990 AT A MEETING HELD ON
SEPT. 9, 1998

E.R. Reed Co. Rep.
E.R. REED

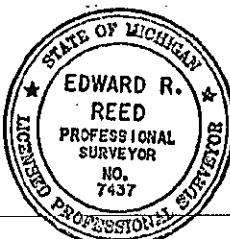

Signed by EDWARD R. REED, P.S.

Date JUNE 1, 1998

Surveyor's Michigan License No. 07437