LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corner

For corners in

Chippewa County	Located	in:		Corner Code #
Public Land Survey		T46N T T T	R7W R R R	J-9
in Section 3. Miscellaneous	S S S	T T T	R R R	
Property in Sec.	š	T	R	

BOOK 11 PAGE 113

\$7.00 LAND CURNER \$2.00 NSSR

23 FEB 2000 4:35:12 PM Receipt #21179 RECEIVED FOR RECORD

CHIPPENA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5. Private Claims

I. Keith R. Waters, in a field survey on November 10, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

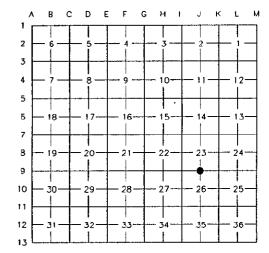

A. Description of original monument and accessories and/or subsequent restoration:

J-9 1/4 Corner Common to Sections 23 & 26, T46N, R7W

1850 - Original corner established by Wells Burt, a spruce post. Witnesses: Spruce 8, N07°W 18 links - Tamarack 10, S22°E 21 links.

Found no evidence of subsequent restoration of this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being reestablished as part of the Chippewa County Remonumentation Program. Found no evidence of the original corner. Reestablished corner by single proportionate measurement midway on line between section corners at I-9 to the west and at K-9 to the east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Placed a 3/2" x 24" rebar with a stamped aluminum Chippewa County Remonumentation cap at the corner location.

Nail and tag #33142 in 14" blazed Cedar, N86°W 16.76'

Nail and tag #33142 in 10" blazed Cedar, S20°W 39.28'

Nail and tag #33142 in 10" blazed Cedar, S07°E 51.88'

Nail and tag #33142 in 8" blazed Tamarack, S32°E 43.28'

OF MICHAEL WAIT 영화업 공연 Tranows

Date 12 - 29 - 99

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN. 1983