

SURVEY & REMONUMENTATION

MAR 29 2000

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN

COUNTY OF CRAWFORD

For corners in SECTION

Crawford

(County)

Located In:

Corner Code #

1. Public Land Survey

T 25N R 3W
T 25N R 2W

M-13
A-13

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

STATE OF MICHIGAN
CRAWFORD COUNTY
RECORDED

17 AUG 99 12:28 P.H.

SANDRA MOORE
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

LIBER

4 PAGE

01

I, Marvin E. Myers, in a field survey on March, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. - 1838

John Brink D.S.

Mon. - Post

9" Birch S38 1/2°E 16 links.

14" Cedar N73°W 15 links

George D. Henning R.L.S.

Unrecorded survey December 1941

Mon: 1 1/4" pipe in Fence line, verified by the stumps of the ORIGINAL US BTs.

Wit: 3" Cedar S54°W 35.61' 5" Cedar north 29.4' 6" Cedar S71°E 28.7'

4" Cedar N53°W 25.5'

George D. Henning R.L.S.

Unrecorded survey February 1942

Mon: 2" Gas Pipe

Wit: 3" Cedar S54°W 54 links 5" Cedar North 44 1/2 links

6" Cedar S71°E 43 1/2 links 4" Cedar N53°W 38 1/2 links

Plat of Northwest Village

Ostling Surveys, INC.

Mon: No description provided

Wit: Witness Mon. S01°53'W 1.0'

C. Eugene Ostling R.L.S. #12026

LORC Liber 1, Page 11, dated 1971

Mon: 3/4" pipe

Wit: Spike in P.P. S89°E 11.9'

Spike in 4" Maple S70°W 31.25'

George D. Henning R.L.S. #2240

Mon: 3/4" pipe in corner

Wit: P. Pole S89°E 11.9'

4" Maple S70°W 31.25'

Norman F. Parker R.L.S. #16939

Mon: concrete monument

Wit: none provided

Larry L. Cavanagh R.L.S. 17614

Mon: no description provided

Wit: Spike in P. Pole S30°E 49.00'

Spike in 16" Red Pine N20°E 8.0'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1 1/4" pipe set in a railroad tie fence post in the intersection of fences North, South, East and West; verified location from Henning witness's.

Found 5" Cedar North 29.4'

Found 6" Cedar Stump S71°E 28.7'

Found 4" Cedar N53°W 25.5'

Found Witness Monument pulled out lying 1.4' South of the corner

Accepted 1 1/4" pipe as a perpetuation of the Original Government Corner. Replaced pipe with Standard Roscommon County monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Mon: Standard Roscommon County Corner in the intersection of North - South & East - West Fences.

Wit: Set Carsonite Post West 0.5'

Set nail & tag in 14" blazed Cedar (previously 4") N53°W 25.95'

Set nail & tag in 12" Cedar N06°E 26.44'

Set nail & tag in utility pole S74°E 12.20'

Signed by

Marvin E. Myers

CRAWFORD COUNTY

Surveyor's Michigan License No. 31600


PEER GROUP APPROVAL

DATE June 7, 1999

Marvin E. Myers

Marvin E. Myers, P.S.
County Surveyor

Date June 9, 1999

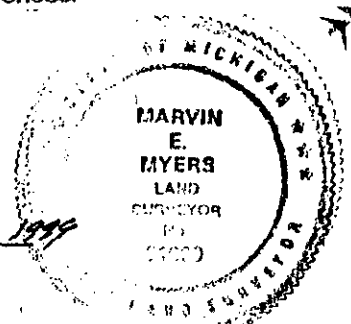

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1971
REVISED JAN., 1971
REVISED OCT., 1971