

# SURVEY & REMONUMENTATION

FEB 22 2001

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
COUNTY OF CHARLEVOIX  
RECORDED

00 DEC 21 AM 9:13

*Charles D. Jouty*  
REGISTER OF DEEDS

For corners in

Charlevoix

SECTION

Located In:

Corner Code #

(County)

1. Public Land Survey

T 33N R 9W

J-13

T R

T 32N R 9W

J-1

T R

2. Property Controlling in Section

S

T R

S

T R

3. Miscellaneous Property in Sec.

S

T R

S

T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Wayne E. Boss, in a field survey on October 20, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

### A. Description of original monument and accessories and/or subsequent restoration:

J-13 June 5, 1839

John Hodgson, D.S.

Placed 1/4 post at 40 chains (2640)

1) Beech 8" N 59° E 20 links 13.2'

2) Beech 9" N 54° E 4 links 2.64'

1898 EKR shows cedar stake North of painted stone

November 9, 1915

E.A. Robinson

Recited EKR notes for D.C. Nettleton

3) Shade-8" S 88° W 63'

4) Shade 7" S 30° 1/2W 107 1/8'

June 18, 1974 NB Deyoung RLS

FD. 1/2" Iron pipe

5) 14" Maple N 85° W 32.85'

6) 30' Maple S 30° 69.90'

July 1, 1974 N. Deyoung

FD. 1/2" Iron pipe

5) 14" Maple N85°W 32.85'

6) 30' Maple S30°W 69.90'

7) Road sign N 35° E 55.3'

May 25, 1976 NB Deyoung

FD. 1/2" pipe

5) 14" Maple N85°W 32.85'

6) 30' Maple S30°W 69.90'

Sept. 1983 Michigan D.N.R.

Found large nail over strong magnetic pull

No witness's noted

August 30, 1984 Arthur Lennox, RLS

FD. Cabin spike in north lane of Old Dixie Highway

5) 18" Maple West 33.7'

6) Apple S40°E 49.0'

7) Street sign N40°E 52.0'

Charlevoix Co. Surveyor

APPROVED

Signature *Mary C. Feindt*

Date: 12-7-00

### B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-13 October 22, 2000 No evidence of original witness

Found large nail stuffed in top 1" x 24" pipe found 7' East of Old Dixie Highway

No evidence of GLO witness

5) 14" Maple N85°W 32.85'

6) 30' Maple S 30°W 69.90'

7) Road sign N 35° 55.30'

8) 1" apple S40°E 49.00'

I-13-J-13 Glo 40 chains (2640), MCF Meas. 2601.2', Mich. DNR 2598.76', WEB 2599.65'

J-13-I-13 GLO 40 chains (2640) measures 2599.59'

### C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-13

Charlevoix County steel marker set in concrete in monument box.

No evidence of GLO witness

5) 14" Maple N85°W 32.85'

6) 30' Maple S 30°W 69.90'

7) Road sign N 35° 55.30'

8) 1" Apple S40°E 49.00'


And is accepted as a careful and faithful reestablishment of the position of the original corner.

Signed by

Date

12/15/2000

Surveyor's Michigan License No.

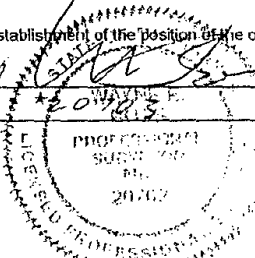

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1976

REVISED JAN, 1983

REVISED OCT, 1996

LIBER 004 PAGE 13