

**DEC 18 1995**

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**

**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Dickinson

(County)

Located In:

Corner Code #

**RECORDED**

NOV 21 AM 11:27

1. Public Land Survey

T 41N R 30W

J-11

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling  
in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

Property in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

**Register of Deeds Stamp & File Number**

I, Robert F. Perkins, in a field survey on Nov. 3, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

J-11 South  $\frac{1}{4}$  Corner, Section 26

Post John Burt, D.S. 1850

Original Bearing Trees

Lynn 10" N 7°E 8 Lks.

Sugar 10" S45°W 22 Lks.

ACCEPTED BY THE DICKINSON COUNTY  
SURVEY PEER GROUP AS THE OFFICIAL  
CORNER UNDER MICHIGAN PUBLIC ACT  
345 OF 1990 AT A MEETING HELD ON

11-26-95

RFP

**COUNTY REPRESENTATIVE**

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

J-11 Found 4" Iron Pipe as noted on Dickinson County Road Commission  
Right of Way Map.

Corner used on numerous Surveys.

Distance checks West to Section Corner.

Accepted Pipe as Best Available Evidence of Corner Location.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

J-11 South  $\frac{1}{4}$  Corner, Section 26

Placed 2 $\frac{1}{2}$ " Stamped Dickinson County Remonumentation Monument  
inside existing Pipe.

New Witnesses


Maple 3" N20°W (M.B.) 13.66'

Maple 3" N72°E (M.B.) 36.40'

Maple 3" S32°E (M.B.) 34.47'

Maple 3" S42°W (M.B.) 39.39'

Carsonite Marker placed 1' South.

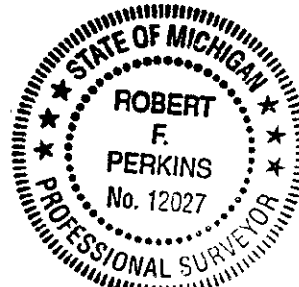

Signed by

*Robert F. Perkins*

Date Nov. 7, 1995

Surveyor's Michigan License No. 12027

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN, 1983