

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Dickinson
Located In:
Corner Code #
Sagola Township
1. Public Land Survey
2. Property Controlling in Section
3. Miscellaneous Property in Sec.
4. Lot No.
5. Private Claims

Register of Deeds Stamp & File Number

Table with 13 rows and 13 columns (A-M) for Register of Deeds Stamp & File Number.

I, Jeremy J. Pipp, in a field survey on 5/10/2012AD do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(J08) Center One-Quarter Corner of Section 23. Not set in original survey. Found 1" pipe (bent; found nail with ribbon at the plumb position) and conduit & 3/8" guard rebar. Position also has an existing BT (9" Maple S46W 20.50') with markings and nail matching that of other corners in this area marked by Edward Kazianka PS#14765. Adjacent landowner (NE) noted this as being the property corner.

(I07) Corner common to Sections 14, 15, 22 and 23. 1848: John Burt, DS. Set wood post witnessed by: Y. Birch 10 S16E 40 links (26.40'); Y. Birch 24 N21W 33 links (21.78'); 1997: Edward Kazianka PS#14765 set Dickinson County Remon. monument witnessed by: 7" Aspen S15E 11.44', 6" Aspen S80W 9.29', 10" Aspen N31W 44.28', 8" Cherry N09E 18.40', Carsonite Marker North 3.0 feet.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J08) Accepted found bent pipe and witness as monumenting said corner location; appears to have subsequent use and has been relied upon as said corner position. Set MDNR monument in place of said existing monument and witnessed.

(I07) Accepted found Dickinson County Remon. Monument and Four existing Witnesses (SW & NW living, NE & SE dead). Left Dickinson County Remon. monument in place and witnessed (note: new nails placed in existing witnesses). Position is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


(J08) DNR monument
8" Maple SOUTH 36.47' (1/4S,NBT)
EX. 9" Maple S46W 20.50' ( - , - )
8" Maple N74W 39.80' (1/4S,NBT)
7" Maple N08W 52.02' (1/4S,NBT)
All trees are blazed, scribed, and painted. Measurements are to nail in side of tree, bearings are magnetic.

(I07) Dickinson Co. monument
5" Spruce N62E 37.99' (S14,NBT)
8" Cherry S19W 57.12' (S22,NBT)
EX. 10" Aspen S78W 9.31' ( - , - )
EX. 14" Aspen N33W 44.30' ( - , - )
All trees are blazed, scribed, painted, and signed. Measurements are to nail in side of tree, bearings are magnetic.
Carsonite Marker North 3.0 feet.

Signed by [Signature]
Surveyor's Michigan License No. 50447
July 18, 2012

For the Michigan Department of Natural Resources, Office of Land and Fisheries

20077
20078

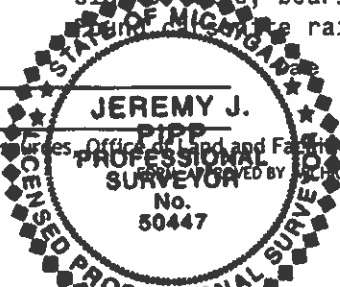

Revised May 14, 1975
Revised Jan., 1983
Revised Oct., 1995