

SURVEY & REMONUMENTATION

MAR 03 1998

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1997 DEC 10 AM 8:07

For corners in SECTION

Dickinson
Sagola Twp.

Located in:

Corner Code #

1. Public Land Survey

T 44N R 30W

I-5 & G-7

T R

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

REGISTER OF DEEDS
DICKINSON COUNTY
RON MUMFORD

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Edward Kazianka, in a field survey on November 6, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-5 Corner common to Sections 10, 11, 14 & 15.

Post set by J. Burt, D.S. in September 1848.

Tamarack 16 S79W 41 lks.

Dept. of Conservation pipe & cap set by Dean DeLaMater on 10-9-51.

Spruce 8 S30W 16 lks. Spruce 8 N15W 18 lks.

G-7 Corner common to Sections 15, 16, 21 & 22.

Post set by J. Burt, D.S. in September 1848.

Tamarack 10 N66W 228 lks. Tamarack 8 S44E 228 lks.

Dept. of Conservation pipe & cap set by H.S. Peterson on 7-16-56.

Spruce 5 N64E 21½ lks. Tamarack 4 S 05E 9½ lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-5 Found Dept. of Conservation pipe & cap.

Tamarack NBT alive. Spruce NBT rotted-off at base.

G-7 Found Dept. of Conservation pipe & cap.

Both NBT's blown-over and dead.

ACCEPTED BY THE DICKINSON COUNTY
SURVEY PEER GROUP AS THE OFFICIAL
CORNER UNDER MICHIGAN P.A. 74, ACT
345 OF 1990 AT A MEETING HELD ON

12-9-97

RDP

COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-5 Dept. of Conservation pipe & cap.

Cedar 5 N32W 16.32 feet. Db1. Cedar 10 N74E 19.85 feet.

Cedar 11 S67E 11.15 feet. Cedar 6 S69W 25.30 feet.

Carsonite Marker N45W 3.0 feet.

G-7 Dept. of Conservation pipe & cap.


Tamarack 6 S 05E 6.00 feet. Tamarack 5 S60E 17.95 feet.

Tamarack 4 S64W 18.70 feet. Tamarack 5 N86E 12.65 feet.

B. Spruce 5 N11W 18.60 feet.

Carsonite Marker S45W 3.0 feet.

All bearings are magnetic.

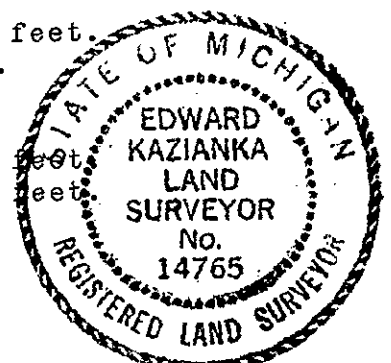

Signed by Edward Kazianka

Date Dec. 10, 1997

Surveyor's Michigan License No. 14765

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

Liber 2 Page 310