

JAN 11 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

00 AUG -8 PM 2: 15

LINDA M. TWITCHELL
REGISTER OF DEEDS
EATON COUNTY, MICH.

For corners in HAMLIN TOWNSHIP

EATON COUNTY

Located In:

Corner Code #

- | | | | | | |
|------------------------------------|---|----|---|----|-----|
| 1. Public Land Survey | T | 1N | R | 3W | J-9 |
| | T | | R | | |
| | T | | R | | |
| | T | | R | | |
| 2. Property Controlling in Section | S | | T | R | |
| | S | | T | R | |
| 3. Miscellaneous Property in Sec. | S | | T | R | |
| | S | | T | R | |

LIBER PAGE 127

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Maurice H. Mahieu, in a field survey on July 7, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- Original Corner set by Hervey Parke during March 1826 at a distance of 40.07 1/2 chains (2644.95') from K-9. "Set 1/4 sec. post at AV dist on True Line. B. Oak 18 N 47° W 15. W. Oak 20 S 1 1/2° W 18."
- Notes in margin to G.L.O. initialed H.A.W. 1922 indicate a 2" gas pipe found with brick. Witnesses: Oak 8" S 70° W 63.60'. Hickory 20" S 47 1/2° E 50.0'. Hickory 12" N 30° E 35 1/2'.
- An Act 132 survey recorded in Liber 1, Page 682-683 by Ron Helsel R.L.S. #18994 on August 19, 1974 describes monumentation as Found 3/4" iron pipe measuring 2660.50' to K-9. Witnesses: S 02° E 50.57' N and C East side 28" Oak, S 35° W 234.93' Southeast corner Fr. Res., N 05° W 22.80' centerline and End of 12" C.M.P.

(Continued On Back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found a 3/4" pipe in a Monument Box in the centerline of Bellevue Road and on mature treelines North and South. Found Nail and Tag #16053 East side 35" Oak South 50.63'. Found Nail and Tag #28414 North side 16" Maple S 68° W 90.60'. Found Nail and Tag West side 21" Hickory South ±68.50' (not measured). Found Nail and Tag #28414 West side Utility Pole N 5° E 62.32'. Found Nail and Tag #28414 North side 5" Red Maple S 71° E 117.63'. Bellevue Road built-up with respect to surrounding landscape at the corner. Accepted the 3/4" pipe as the perpetuated location of the corner, and replaced it with a 3/4" x 24" iron form pin and a 2 1/2" diameter Aluminum P.A. 345 Cap #28414.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A 3/4" x 24" iron form pin with a 2 1/2" diameter aluminum P.A. 345 Cap #28414 in a Monument Box, witnessed by:
Found Nail and Tag #16053 East side 35" Oak, South 50.63'
Found Nail and Tag #28414 North side 16" Maple, S 68° W 90.60'
Found Nail and Tag #28414 West side Utility Pole, N 5° E 62.32'
Found Nail and Tag #28414 North side 5" Red Maple, S 71° E 117.63'

Signed by Maurice H. Mahieu
Surveyor's Michigan License No. 28414

Date 8-03-00

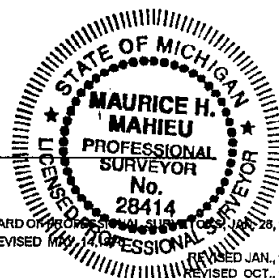

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS JAN 26, 1971
REVISED MAY 1983
REVISED JAN., 1983
REVISED OCT., 1995

P.A. 345 EATON COUNTY
PEER APPROVED 8/01/2000 RL

4. An Act 132 survey recorded in Liber 2, Page 501-504 by Ronnie Lester, R.L.S. #18998 on December 28, 1977 describes monumentation as Found $\frac{1}{2}$ " pipe, measuring 2658.44' to K-9, and 2653.27' to J-8. Witnesses: $\frac{1}{2}$ " bar and cap #18998, North 33.00'; Nail and Tag in East side 24" Oak, South 50.18'; Southeast Corner Foundation House, Southwest 235.02'.
5. An Act 132 survey recorded in Liber 2, Page 958-959 by Ronnie Lester, R.L.S. #18998 on June 26, 1979 describes monumentation same as in A-4, measurements same as in A-4, Witnesses same as in A-4.
6. A L.C.R.C. Recorded in Liber 2, Page 797 by Maurice H. Mahieu, L.S. #28414 on June 23, 1982 describes monumentation as $\frac{3}{4}$ " pinch pipe, witnessed by Nail and Tag in West side 10" Elm Tree, N 02° E 64.12'; Nail and Tag in East side 30" Oak, S 01° W 50.65'; Nail and Tag in West side 20" Hickory S 01° W 68.45'; Nail and Tag in East side 6" Maple, S 50° W 103.66'.
7. An Act 132 survey recorded in Liber 3, Page 470 by James Stephens, R.L.S. #14062 on October 12, 1982 describes monumentation same as in A-6, measuring 2652.55' to I-9, witnesses same as in A-6.
8. An Act 132 survey recorded in Liber 4, Page 79-80 by Fred White R.L.S. #12034 on August 12, 1985 does not describe monumentation. Corner measured 2653.16' to J-8, and 2658.37' to K-9, with no shown witnesses.
9. An Act 132 survey recorded in Liber 5, Page 710 by Glenn Fauser, R.L.S. #18657 on January 12, 1994 describes monumentation and witnesses same as in A-6. Corner measured 2653.30' to I-9.
10. An Act 132 survey recorded in Liber 6, Page 377-378 by Glenn Fauser, R.L.S. #18657 on September 5, 1996 describes monumentation same as in A-6. Corner measured 2622.90' to I-9. Witnesses same as in A-6.
11. An Act 132 survey recorded in Liber 6, Page 397-399 by Lary A. Bryan, R.L.S. #25832 on September 17, 1996 describes monumentation same as in A-6 measuring 2648.48' to J-10. Witnesses: Found Stephens Nail and Tag East side 36" Oak South 50.65'; Found Nail and Tag North side 10" Maple S 75° W 120.90'; Set Nail and Tag North side 10" Maple S 50° W 90.68'; Set Nail and Tag East side of Power Pole North 62.50'.
12. An Act 132 survey recorded in Liber 6, Page 605-607 by Lary A. Bryan, R.L.S. #25832 on December 27, 1996 describes monumentation same as in A-6. Witness and measurement to J-10 same as in A-11.
13. An Act 132 survey recorded in Liber 6, Page 608-610 by Lary A. Bryan, R.L.S. #25832 on December 27, 1996 describes monumentation same as in A-6. Witness and measurement to J-10 same as in A-11.
14. An Act 132 survey recorded in Liber 6, Page 935-937 by Lary A. Bryan, R.L.S. #25832 on June 9, 1997 describes monumentation same as in A-6. Witness and measurement to J-10 same as in A-11.
15. An Act 132 survey recorded in Liber 7, Page 256 by Lary A. Bryan, R.L.S. #25832 on November 18, 1997 describes monumentation same as in A-6. Corner measured 2652.59' to I-9, and 2648.48' to J-10. Witnesses same as in A-11.
16. An Act 132 survey recorded in Liber 7, Page 751 by Anthony Burnstead, R.L.S. #41095 on September 1, 1999 describes monumentation as Found $\frac{1}{2}$ " pipe in centerline of Bellevue Highway on fence line North and South. Corner measured 2658.48' to K-10, and 2653.13' to J-8. Witnesses: Found Nail and Tag East side 30" Oak, South 50.65'; Southeast Corner Foundation House, Southwest 235.02'; Nail and Tag West side 10" Elm, N 02° E 64.12'.
17. An Act 132 survey recorded in Liber 8, Page 751 by Anthony Burnstead P.S. #41095 on September 1, 1999 describes monumentation same as in A-4. Corner measured 2658.48' to K-9. Witnesses: Found Nail and Tag East side 30" Oak, South 50.65'; Southeast Corner Foundation House Southwest 235.02'; Nail and Tag West side 10" Elm N 02° E 64.12'.
18. An Act 132 survey recorded in Liber 9, Page 56-57 by Fred White, R.L.S. #12034 on February 22, 2000 describes monumentation as Found $\frac{3}{4}$ " pipe, measuring 2652.60' to J-10 and 2652.57' to I-9. Witnesses not given.

SURVEY &
MONUMENTATION

JAN 11 2001

SECTION