

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --	LOCATED IN --	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 26 N. R. 9 W.	G-3; G-4
2. PROPERTY CONTROLLING IN SECTION 10	T. 26 N. R. 9 W.	1; 4
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. , RECORDED PLAT		
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on January 24, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by Decree of a Court of law:

A. - Description of original monument and accessories and/or subsequent restoration:

C. (continued)

4

Set 5/8"x36" rerod w/RLS cap &
cedar post w/loc. tag
9" Oak S34°E 10.8
4" W. Pine N62°W 9.8
20" W. Pine N46°E 16.5

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-3 Fd. & accepted 1½" sq. iron for NW cor. Sec. 10 Corner used by Richards in 1972, Norton in 1959 & Kobbin in 1964 surveys.
- G-4 Fd. & accepted cor. as set by M. Schaaf (1930's) from measurements, from fd. original corners ½ mile N & ½ mile S (fits exact for SP N-S & 6± W of straight line).
- 1 Fd. & accepted 1/8 corner as set by Richards-Findorf-Richards in 1972 survey of Sec. 5.
- 4 Set center of NW¼ of Sec. 10 per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-3

Fd. 1½"x1½" iron & added loc.
tag to cedar post
7" Cedar S70°E 22.0
10" Maple S83°W 36.5
6" Balsam S73°E 11.48
8" W. Birch N58°E 7.43
6" Balsam N34°E 6.22
6" W. Birch N03°W 5.91

G-4

Fd. (Schaaf mon.) 1½" pipe
in conc. (buried 0.4')
6" Oak N53°E 29.0
5" Maple S60°E 30.6
11" W. Pine S40°W 65.7
Set cedar post w/loc. tag
Due E 16.5

1

Fd. rod w/RLS cap #12165 & set
cedar post w/loc. tag
5" Cedar N58°W 5.37
5" Cedar N81°E 5.74
5" Cedar S62°E 11.8

SIGNED BY 5-6-80 Carl F. Roser DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE

MICHIGAN REGISTERED LAND SURVEYOR

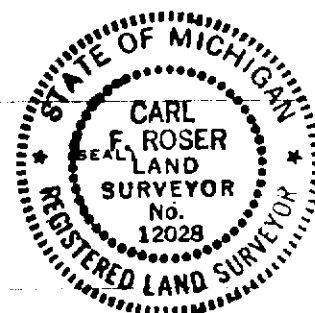

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

GRAND TRAVERSE COUNTY
UNION TOWNSHIP

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET