LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Houghton (County)	_ Located In:	Corner Code #	*		
1. Public Land Survey	T 51N R 36W	MC N. of A13 (GCDB 100109)			
 Property Controlling in Section Miscellaneous Property in Sec. 	S T R S T R S T R S T R		Register of Du	eeds Stamp & I	File Number
4. Lot No. , Red 5. Private Claims	corded Plat			EFGH	IJKL
I, Stephan J. Szyszkoski, in that under requirements of P.A. above were in conformance with instructions of the United States a Court of Law and /or that the other rules of the Michigan Boar re-established, monumented, recovery	74, Michigan P.A. of 1970, the corregulations and rules therefore as re Department of the Interior, Bureau corner points mentioned in lines 3, 4 d of Land Surveyors or by a De	06/11/14 do hereby state oner points mentioned in tines 1 and equired in the current manual of surver of Land Management or by a decree of 4 and 5 above were in conformance with coree of a Court of Law; established	2 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9	9 10 16 15 21 23 28 2 ·- 28 2	2 1 1 12 12 5 14 13 2 2 23 24 2 7 26 25 25
on this certificate.	iers, all in the same town and ra	ange, may be recorded N	11 12 31 32	3337	35 -36-

A. Description of original monument and accessories and/or subsequent restoration:

Meander Corner on the north shore of Six Mile Lake between Section 36 T51N-R37W and Section 31 T51N-R36W. 1854 - Established by Wm.A.Burt Deputy Surveyor 6.82 ch. North of the position for A13 and 33.18 ch. South of A12. Set post. Tamarack 6" N75°E 79 links, Tamarack 6" N14°W 136 links. Witnesses following are numbered to correspond to those in Part B. 1957 - MSHD highway plans show 3/4" iron pipe at the corner with witnesses: 1) 12" Birch N25°W 25.42'; 2) 12" Pine stp. N15°E 23.55'; 3) 10" Oak S65°E 44.50'. 1979 - K.L.Sackett RLS records that he restored the corner position from the MSHD witnesses and set a 1"ID I.pipe with 4" alum. cap witnessed by: 4) 18" W.Pine N38°W 33.4'; 5) 23" W.Pine N89°E 70.4'; 6) Concrete ROW marker N07°E 12.2'. 1990 - R.Crampton RLS records that he found a 1" iron pin from MSHD notes, witnessed by nail and tag in: 7) 23" W.Pine N34°W 33.67'; 8) 9" W.Birch N50°E 33.62'; 9) 18" Oak S64°E 43.73'; 10) Center of conc. ROW marker N07°E 12.45'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found a 1" dia. iron pin set flush, in good condition, in accord with the witnesses of record referenced above: 1) a stump; 2) not found 3) in good condition. Set new witness nail in this tree (see below); 4) now standing dead with scribing "MC NBT" visible; 5) a stump; 6) measured 12.2' to south face and 12.35' to center; 7) same as 4); 8) now standing dead, about 25' tall with overgrowth covering tag; 9) same as 3)-overgrowth covers the 1990 witness tag; 10) same as 6). I note that the position of this monument is 30.923 chains (2040.91') south of corner A12 and it is likely not the original Meander Corner position but, rather, a witness corner to the MC. Based on record GLO distance to A12, the MC is 148.97' south of this position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found 1"ID iron pin.

Set measuring nail with MDNR tag in the side of:

18" Oak S65°E 44.3' with old overgrown blazes

6" Oak N46°E 13.4' mrkd "MC NBT"


6" Oak S45°E 4.05' do

C/L of Conc R/W post N08°E 12.35'

Set sq'd cedar post adjacent.

E= 7852404.656 N= 222224.863

0

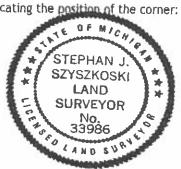

Bearings are magnetic. Coordinates are MCS83 in meters (NAD83(2011) Datum). Coord. Ref.=NGS PID RL0607: N=222113.185 m. E=7850163.394 m.

Signed by Stiphe Systhal		Date	06/30/2014	
Surveyor's Michigan License No.	33986			

1

Revised Jan., 1983 Revised Oct., 1995