

SURVEY &
REMONUMENTATION

FORM NO. 985-A



Stock No. 26273

MAR 19 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

	Iron (County)	Located In:	Corner Code #
1. Public Land Survey		T <u>42N</u> R <u>33W</u>	<u>G-8.9a(010)</u>
		T _____ R _____	_____
		T _____ R _____	_____
		T _____ R _____	_____
2. Property Controlling in Section	S _____	T _____ R _____	_____
	S _____	T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____	T _____ R _____	_____
	S _____	T _____ R _____	_____

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

96 DEC 23 AM 9:10
L.C. Records L. 7, P. 87
Gary L. Pisoni
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

North Meander Corner between Sections 21 & 22, T42N R33W

I, Gary L. Pisoni, in a field survey on November 21, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Guy H. Carleton, U.S. Deputy Surveyor in 1851.

Original corner: Wood Post

Original bearing trees:

Hemlock 10" N 53° W 44 links (29.04 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original corner evidence found.

Found a Plat Concrete Monument with drill rod in center which was set from the Assessor's Plat of Gursky dated 1961. Said monument is 79 feet from waters edge.

Accepted Plat Monument as the best available evidence for restoring corner position and set a Witness Corner 1 foot North of Plat Monument, stamped to read: Iron County Remonumentation, T42N, R33W, S-21, S-22, W.C., M.C., S 00° 18' W, 1.0', 1996, RLS-27457.

Corner Record Research on file with County Representative.


PEER GROUP APPROVED

Gary L. Pisoni 12-11-96
COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

From the above described Plat Monument, blazed and scribed the following new bearing trees:

Black Cherry	7"	N 35° E	54.10 feet
Black Cherry	8" DbL.	N 73° E	25.01 feet
Black Cherry	4"	S 24° W	22.51 feet
Red Maple	9"	N 60° W	37.24 feet
W.C.	3/4" x 36" Aluminum		
M.C.	Rod with cap	N 00° 18' 03" E	1.00 feet
Steel Sign Post	6'	South	1.25 feet

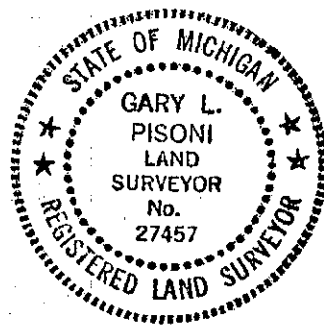

#96-65

Signed by *Gary L. Pisoni*

Date 12-10-96

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

L. 7 P. 87