

SURVEY & REMONUMENTATION

FEB 21 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>31W</u>	<u>E-9</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

COMMENCING YEAR 2000
RECEIVED RECORD
IRON COUNTY, MICHIGAN

00 DEC 22 PM 3:27
L.C. Record: L. 8, P. 326
William L. Pisoni
Surveyor

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Section Corner to Sections 20, 21, 28 and 29, T43N, R31W

I, Gary L. Pisoni, in a field survey on December 1, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on July 17, 1849 by John Burt, U.S. Deputy Surveyor.

Original Corner; Sugar Post

Original Bearing Trees:

White Pine	16"	N 58° W	24 links (15.84 feet)
Yellow Birch	12"	S 05° E	32 links (21.12 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Location tag bears N 45°25' E, 78.1 feet from corner position.

Corner located on top of a rock ledge hill.

Restored the corner position by double proportionate measurement from the Northeast corner of Section 20 to the Southeast corner of Section 29 and from the Northeast corner of Section 28 to the Northwest corner of Section 29.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, set a brass cap cemented into the rock ledge surface with a 3" diameter brass cap stamped as follows: Iron County Remonumentation, T43N, R31W, S-20, S-21, S-29, S-28, 2000, RLS 27457 from which I established the following new blazed and scribed bearing trees: (all measurements taken to a nail in side of tree)


Red Maple	8"	South	33.52 feet
Cedar	10"	N 86°W	5.01 feet
Cedar	6"	N 06°W	4.70 feet
Cedar	6"	N 39°E	15.81 feet
Steel sign post		S 47°W	6.2 feet

00-094

Signed by Gary L. Pisoni Date 12-19-2000

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

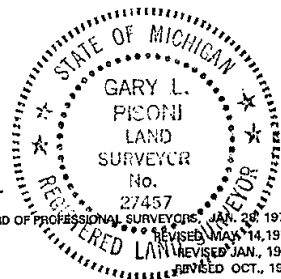

LIBER

8 PAGE 326