

MAR 09 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

	Iron (County)	Located In:	Corner Code #
1. Public Land Survey		T <u>43N</u> R <u>32W</u>	<u>F.G-9</u>
		T <u>    </u> R <u>    </u>	<u>(004)</u>
		T <u>    </u> R <u>    </u>	
		T <u>    </u> R <u>    </u>	
2. Property Controlling in Section	S <u>    </u>	T <u>    </u> R <u>    </u>	
	S <u>    </u>	T <u>    </u> R <u>    </u>	
3. Miscellaneous Property in Sec.	S <u>    </u>	T <u>    </u> R <u>    </u>	
	S <u>    </u>	T <u>    </u> R <u>    </u>	

IRON COUNTY  
MICHIGAN  
RECEIVED FOR RECORD

99 DEC 30 AM 10:23

L.P. Records: L.S.P. 80  
*Robert J. Pisoni*  
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

4. Lot No.         , Recorded Plat           
5. Private Claims         

West Meander Corner to Sections 21 and 28, T43N, R32W

I, Gary L. Pisoni, in a field survey on Dec. 18, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on August 13, 1849 by Z. B. Searls, U.S. Deputy Surveyor.  
Original Corner; 10" White Pine Meander Corner  
Original Bearing Trees:

No B. T.s established

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original White Pine Meander corner found.

Restored the Meander Corner position on the West shore of Runkle Lake and on line between the South quarter corner of Section 21 and the East meander corner between Sections 22 and 27 on the East shore of Runkle Lake. Meander corner is 60 feet from waters edge.

Monument is located in the swimming beach area and buried 8" below ground surface.

Corner record research on file with County Representative.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, set a 2" diameter by 30" long split base aluminum pipe monument, with a 3" dia. aluminum cap stamped as follows: Iron County Remonumentation, T43N, R32W, S-21, S-28, M.C., 1999, RLS 27457 from which I established the following bearing tree: (All measurements taken to a nail in side of tree)

Utility Pole		N 30° W	163.10 feet
Red Pine	24"	S 05° E	140.09 feet
Rebar	5/8" x 30"	S 89° 42'21"W	156.00 feet
Steel sign post		S 89° 42'21"W	156.8 feet

PEER GROUP APPROVED  
*Iron Gary L. Pisoni 12-31-99*  
COUNTY REPRESENTATIVE

99-80  
Signed by Gary L. Pisoni Date 12-28-99  
Surveyor's Michigan License No. 27457

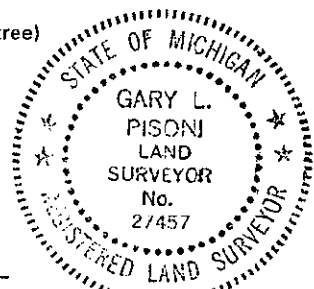

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995