LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

	i i		
lron (County)	Located In:	Corner Code #	
(County)			
1. Public Land Survey	TR		2
	T		
2 Proporty Controlling	RR		
2. Property Controlling in Section	S 20 T 45N R 33W	D8	
, 55521011	s	(GCDB 240340)	
3. Miscellaneous	s		**
Property in Sec.	s T R		
4 Lot No. De	acade d Dist		Register of Deeds Stamp & File Number

5. Private Claims

t, Stephan J. Szyszkoski, in a field survey on 05/21/14 that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey 5 instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of 6 a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with 7 the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, 8 re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Center of Section 20. Not previously monumented.

, Recorded Plat

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Established the position for the corner at the intersection of straight lines connecting opposite 1/4 corners. The position for the corner falls between the rails of the Soo Line Railroad and was not monumented. I established a WITNESS CORNER to the corner position on the N-S 1/4 line of Section 20, 25.00 feet south of the corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 1"IDx28" I.pipe with 2" alum. MDNR cap stamped "W.C. C1/4 NORTH 25.00' SEC 20". This monument is located on the N-S 1/4 line 25.00 ft. south of the corner position. Witnesses to the W.C.:

NE corner fence post N48°E 94.24'


SE corner fence post S68°E 110.22'

NE cor. WE ENERGY metal transformer case S54°W 184.15

SE cor. RR signal bldg. N70°W 266.63'

Set sq'd cedar post adjacent.

E= 7887455.551 N= 167654.621 (the C1/4 cor. proper).

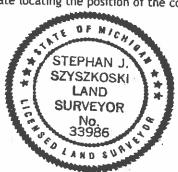

10

Bearings are magnetic. Coordinates are MCS83 in meters (NAD83(2011) Datum). Coord. Ref.=NGS PID RL0476: N= 196482.411 m. E= 7879234.516 m.

Signed by

Date

10/02/2014

Surveyor's Michigan License No.

For corners in

4. Lot No.

33986

For the Michigan Department of Natural Resources, Forest Resources Division

Revised Oct., 1995