


10735

Survey &
Documentation

JAN 19 2001

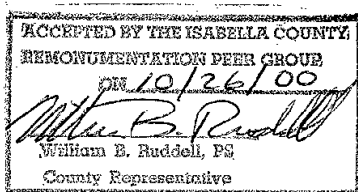

Isabella County Remonumentation Program
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

ISABELLA Located In: Sherman Twp. Corner Code
(County)

1. Public Land Survey T 15N R6W C-2
T R
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, John H. Rauser, P.S., in a field survey on November 1 20 00, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- C-2 1/4 Corner common to Section 5 & 6, T15N-R6W, Sherman Township, Isabella County
1847 GLO wood post placed by Arron Lynn, D.S., during resurvey of T15N-R6W, listed two accessories:
Beech 20" S58½E 20 lks (13.20')
Beech 10" N42W 37 lks (24.42')
- 1974 Certified Survey Act 132 by Gerald Gray, #17741, found 1" square iron rod. Measured 2729.60' to C-1.
1974 L.C.R.C. #00325, by Gerald Gray P.S.#17741, Found 1" Sq. Iron.
1981 Recorded Survey 132, L.003, Pg. 606, Thomas J. Mueller P.S.#25861, found Stake W/ iron under.
1988 Road commission witness page calls for nail, witnessed by: N65E 97.55' Spike in PP, SSE 51.25' Spike in 18" Maple, SE 29.25' Spike in 24" Maple
1997 L.C.R.C. #1370, by Ronald Harris P.S. #41917, Fnd square iron, raised with capped re-rod.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-2 1/4 Corner common to Section 5 & 6, T15N-R6W, Sherman Township, Isabella County

Corner is existent. Found no physical evidence of original government corner or accessories. Found re-rod as called for by 1997 record. Removed re-rod and excavated. Found 1" square iron bolt set in the top of an old wagon skien. Removed and excavated to a depth of 4', but found no other evidence. We accept the found wagon skien as a careful and faithful perpetuation of the position of the original government corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-2 1/4 Corner common to Section 5 & 6, T15N-R6W, Sherman Township, Isabella County

Set standard Isabella County monument and monument box in curve in road 5' west of centerline south and 5' south of centerline west, stamped C-2, #39096.

ENE 73.50' Nail w/tag in 6" maple OST (1997)
SE 29.5' Nail w/tag in 24" maple OST (1981)
SSE 51.25' Nail w/tag in 24" maple OST (1975)
SW 40.7' Road sign post (1997)


Signed by John H. Rauser
Surveyor's Michigan License No. 39096

Instrument Liber Page
200000010735 1 354

200000010735
Filed for Record in
ISABELLA COUNTY, MI
SHARON A BROWN
On 12-08-2000 At 02:33:21 pm.
RE LAND COR 9.00
Liber 1 Page 354 - 354

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

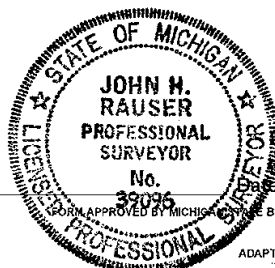

12/7/00
FORM APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1995