

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|---|---------------|---|
| 1. PUBLIC LAND SURVEY_____ T. <u>28</u> N. <u>5</u> W. <u>5</u> | | <u>G-11; G-12; H-11;</u> <u>I-12</u> |
| 2. PROPERTY CONTROLLING IN SECTION_____ ,T. _____ N. _____ S. _____ E. _____ W. _____ | | |
| 3. MISCELLANEOUS PROPERTY IN SECTION_____ ,T. _____ N. _____ S. _____ E. _____ W. _____ | | |
| 4. LOT NO. _____ , RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on Oct. 5, 19 77, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A- Description of original monument and accessories and/or subsequent restoration:

C. (continued)

I-12

Replaced fd. rod & pipe with
DNR Mon. & ced. post.

| | | |
|-----------|-------|------|
| 12" Maple | S40°E | 18.2 |
| 9" Beech | S58°W | 36.2 |
| 8" Maple | N39°W | 13.2 |
| 8" Maple | N53°E | 27.0 |

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-11 Fd. 5/8"X2" Ir. bar (1968) & raised with 1 1/4" pipe. Cor. Falls in approx. Ctr. of N-S B. Top rd. & ctr. of E-W power line.
- G-12 Estab. 1/4 Cor. Equidistant & on line btw. fd. cor's to N&S. Fd. 1" pipe S77°06'W 34.21' is an approx. cor. only near rd. R.O.W. Line as stated by adjoining land owner R. Brown.
- H-11 Recovered Dept. Mon. as estab. in previous Dept Survey (1968 by preportionate measure.
- I-12 Fd. 1/2" Rerod & old thin 1" pipe, that fits very reasonable with found sec. Carmers 1/2 mile to N. & S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-11

Fd. 1 1/4" pipe.
12" Maple S30°W 52.73
NE cor. sub sta.fence S36°W 76.6
10" Maple N25°W 77.51
(W90) Power pole S84°E 59.11
Set ced.post w/Loc. tag
Due E 33.0

G-12

Drove 1 1/4"X18" Iron Pin
in B.Top Rd.
10" Maple S72°W 26.45
6" Maple N45°W 50.54
9" Maple S70°E 39.61
Ctr. N-S B.Top Rd.
Due E 3'+
Set ced.post w/Loc.Tag
Due W 30.0

H-11

Fd. D.N.R. Mon Set Ced. post
6" Maple N07°E 56.8
Power Pole S86°E 102.38
10" Maple S53°W 68.0
8" Maple N18°W 89.8
Cor. in Approx. Ctn.of E-W
Power Line.

SIGNED BY

Carl F. Roser

DATE

3-31-78

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY

DATE


CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY

DATE

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

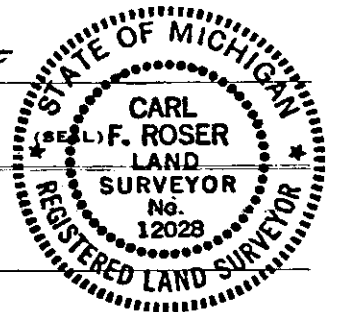

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

BLUE LAKE TOWNSHIP
KALKASKA COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET