

SEP 1 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
KENT COUNTY REMONUMENTATION

For corners in

Kent
(County)

Located in:

Corner Code #

1. Public Land Survey

T 5N R 12W

H-11

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD
55 AUG 28 AM 10:52
8622
REG. OF DEEDS


Register of Deeds Stamp & File Number

I, Randy Kolehouse, in a field survey on April 7 19 95, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

H-11	1831	G.L.O. Notes	Mullett	Set Post
	N/A	Wit. Map	K.C. Surveyor	Iron in Monument Box
	1974	L.C.R.C. #961	Don Ratekin	Found 1/2" Iron in Mon. Box
	1981	L.C.R.C. #2300	Nederveld & Jonker	Found 1/2" Iron in Mon. Box/Set K.C. Monument
	1991	L.C.R.C. #6324	Chris Marschall	K.C. Monument

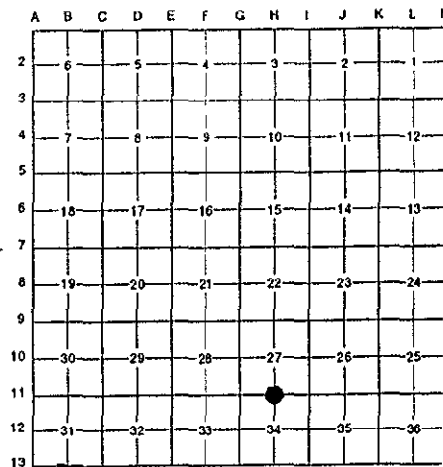

P.A. 345 1990 KENT COUNTY
PEER APPROVED 5/29/99
CHAIRMAN Randy Kolehouse

This corner was originally approved by the Kent County Remonumentation Peer Group and monumented by Nederveld & Jonker on 9/1/81 and was recorded per L.C.R.C. #2300.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-11 Found standard Kent County Monument in monument box 1.0' North of C/L of 100th Street running E-W and on C/L of Celery Avenue running North per L.C.R.C. #2300 and #6324 as set by Nederveld & Jonker in place of a 1/2" iron in monument box they found which checked L.C.R.C. #961 and K.C. Surveyor's Wit. Map.

L.C.R.C. #2300

L.C.R.C. #6324

SE cor. conc hdwl S50°W 31.59'
Nail & K.C. Remon. tag E side P. pole N25°W 53.60'
NE cor. hse ind. S30°W 78.0'

SE cor. conc. Hdwl S 50 W 31.62'
Nail & Tag E sd P.P. N 25 W 53.63'
Chiseled "X" in Top of 30" conc. culvert N 35 E 33.62'
Chiseled "X" in Top of 30" conc. culvert N 30 W 35.37'
NE Corner House Fdn. S 30 W 77.99'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-11 Standard Kent County Monument

SE cor. conc. Hdwl S 50° W 31.62'
Nail & K.C. remon. tag on E side P. pole N 25° W 53.63'
Chiseled "X" in top of 30" conc. culvert N 35° E 33.62'
Chiseled "X" in top of 30" conc. culvert N 30° W 35.37'
NE corner house fndn. S 30° W 77.99'



Signed by Randy J. Kolehouse

Date 8/21/95

EARTH TECH

Surveyor's Michigan License No. 25854