MAY 1 6 1996

Property in Section

COMMISSION

Cooper Township

LAND	CORNER R	ECORDAT	TION CEP	RTIFI	CATE
Filing	Requiremen	nt of Act 7	'4, Mich.	P.A.	1970

For corners in Kalamazoo Located In: Corner Code # 1. Public Land Survey T 2. Property Controlling __T _ in Section ___ T __ 3. Miscellaneous

1PAGE 1467

Register of Deeds Stamp & File Number


LIBER

4. ⁻	Lot No.	, Recorded Plat	
5.	Private Claims		

6. IWM Job #'s 24071, 24991, 27425, 27585

I, Allen H. McMachen , in a field survey on January do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

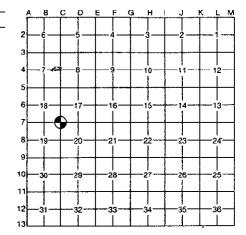

A. Description of original monument and accessories and/or subsequent restoration:

1827 - John Mullet, D.S., Corner to Sections 17, 18, 19 & 20 on a yellow Oak 20"

1869 - F. Hodgman, C.S., At the corner of Sections 17, 18, 19 & 20. A stone is set said by the inhabitants to be in the place of the original corner tree, Wits, Hickory 12" N. 461/4° E. 84 lks. Hickory 6" S. 391/4° E. 81 lks.

1931 - W. Wilkins, Found stake and stone 1940 - W. Wilkins, Found stone. Stone drilled, stake under, S.E. corner conc. block pump hse. N.W. 108.35', N.E. corner barn S.W. 111.15', 20" Elm S. 50° E. 94.18'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron in mon. box. Removed iron and box and excavated to a depth of 4.5 feet and found no additional marker. Position of 1/2" iron matches Wilkins 1940 witness to block pump house. Meas. West to iron at N¼ cor. @ 2651.71' (1940 Wilkins = 2652.76'). Meas. South to iron at E¼ cor. @ 2652.05' (1940 Wilkins = 2652.2').

> RATIFIED BY KALAMAZOO COUNTY REMONUMENTATION PEER GROUI

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found 1/2" iron in mon. box is accepted as the best available evidence of the position of the corner. Replaced found 1/2" iron with a Harrison monument and placed monument box over, Accessories:

"PK" Nail & Tab in S.E. side Utility Pole N. 50° E., 44.66' "PK" Nail & Tab in S.E. side Utility Pole S. 50° W., 67.54' Nail & Tab in N.E. side 24" Pine S. 43° E. 59.64' S.E. cor. conc. block pump house (at grade) N. 30° W. 108.39'

No. 16935 PROFESSIONAL

CHY

ALLEN H. McMACHEN

PROFESSIONAL

SURVEYOR

Surveyor's Michigan License No.

Signed by

REVISED MAY 14, 1975