

JAN 2 2 2001

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee
(County)


Located In:

Corner Code #



LIBER 2

PAGE 23

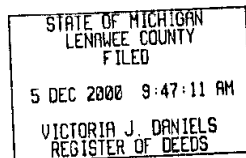

1. Public Land Survey

T - 6 - S R - 3 - E

A-3

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous

S T R

Property in Sec

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

I, Glenn E. Richard, in a field survey on October 26, 2000

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 John Mack D.S. Intersect W. bdy 8 chains (528') S. of post. Set post at intersection cor. Sec.'s 6 & 7 Elm 17 N 38 E 37 W. Ash 7 S 31 W 26

Early 1900's J. L. Richard's record called for iron, bricks and small stones

1927 J. L. Richard & Harold Clegg surveyed the road from Adrian to Onsted. The road plans call for "sta 338+96 SW corner Section 6 Gas Pipe, added Brick and Tile."

1933 Walter Frazier "Located N.W. Corner Sec. 7 T6S R3E "gas pipe and stone located previously at time of highway survey and used later at time of survey of property to the west"

1951 Walter Frazier used corner. Type of monumentation not given

1960 I found iron pipe

1977 I found iron pipe and recorded it in Liber 3, Page 529

1978 Kenneth Suydam found iron pipe

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

September 26, 2000 The peer group approved the location of the found monumented corner to be corrected west to the Town line.

October 26, 2000 I set a 30" Harrison Monument 2.59 west on extension of line west from B-3 T6S R3E thru the found monumented corner recorded in Liber 3, Page 529 to be on the line between the corners approved by the peer group at M-3 and M-4 T6S R2E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument (top 6" deep) and is accepted as the best available evidence of the position of the amended corner.

dbl hd nail & re-mon tag in E. face 36" Maple S 20° W 126.12


dbl hd nail & re-mon tag in W. face E.P. N 35° E 182.33

SW corner of house foundation N 70° E 189.06

"X" cut on S. end CMP S 75° E 83.05

Property controlling corner (iron pipe) East 2.59

M-3 T6S R2E North 530.91

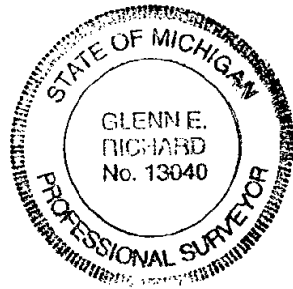

Ratified by Peer Group in accordance with P.A. 345

Co. Rep. Glenn E. Richard Date September 26, 2000

Signed by Glenn E. Richard

Date Nov. 8, 2000

Glenn E. Richard

Surveyor's Michigan License No. 13040