

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)

Located In:

Corner Code #



LIBER 2

PAGE 26

1. Public Land Survey

T - 6 - S R - 3 - E

K-11

T R

T R

T R

2. Property Controlling
in Section

S T R


S T R

3. Miscellaneous

S T R

Property in Sec

S T R

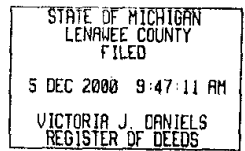

Register of Deeds Stamp & File Number

4. Lot No.

Recorded Plat

5. Private Claims

I, Glenn E. Richard

in a field survey on November 13, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 John M. Mack D.S. Set post cor. Sec.'s 25, 26, 35 & 36 Elm 10 S 35° E 41 W. Oak 15 N 35° W 15
Early 1900's John L. Richard record Old stake, bricks and stone.
1927 Fred Soll P.S. 1090 surveyed the Girls Training School in Sections 25 and 26 for the State of Michigan. The certificate indicates that he found a monument (type not given)
1959 while employed by Walter Frazier I found brass capped monument
1965 I found brass capped monument
1972 Werner Sommer found brass capped monument and set iron pipe 32.00 East
1973 Werner Sommer found brass capped monument and recorded it in Liber 2, Page 261
1976 I found brass capped monument. Center of top nut of fire hydrant S 30° E 15.97. NE corner of brick office building S 10° W 79.70. NW corner of brick office building S 80° W 98.93
1987 Peter Beaver P.S. 25828 did a survey and shows the corner "L 2 P 261"
1995 Dave Erickson found brass cap in concrete monument
2000 Michael Bartolo found 4" brass disk "cut "X" on S. rim of manhole N 10° W 23.84. NE cor. brick office building S 25° W 79.70. Top nut of fire hydrant S 10 E 16.00. Nail & brass tag in N. face 18" Pine S 25° E 22.65.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Nov. 13, 2000 Fd. "State of Michigan" monument 8" deep. (4" iron pipe with brass cap). Set 2' X 6" PVC pipe around it with Bernitsen access cover with small drill hole in cover over the center of the found monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

4" iron pipe with brass cap stamped "State of Michigan" 8" deep under Bernitsen access cover with small drill hole over the center of the monument and is accepted as the best available evidence of the position of the original corner.

Top nut of fire hydrant S 35° E 16.01
Fd. iron pipe East 32.01
Fd. "X" cut on rim of M.H. N 35° W 23.86
Fd. brass tag in N. face of 18" Pine S 60° E 22.63
NE corner of brick building S 10° W 79.68
NW corner of brick building S 75° W 98.88
Carsonite witness post N 45° E 0.8

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date November 28, 2000Signed by Glenn E. Richard Date Nov. 30, 2000
Glenn E. RichardSurveyor's Michigan License No. 13040