

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee

(County)


Located in:

Corner Code #



LIBER 2

PAGE 14

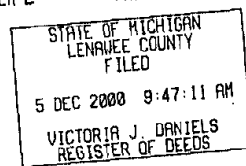

1. Public Land Survey T-7-S R-1-E L-5  
T R  
T R  
T R
2. Property Controlling S T R  
in Section S T R
3. Miscellaneous S T R  
Property in S S T R

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Glenn E. Richard, in a field survey on October 4, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

1824 Ziba Swan D.S. set 1/4 Sec. post W. Ash 8 S 1 E 12 Beech 18 N 4 W 10  
 1874 Burton Kent surveyed SW 1/4 of Section 12. Type of monumentation not given.  
 1877 G.E. Kedzie surveyed SW 1/4 of Section 12 and NW 1/4 of Section 13 and called for stone  
 1887 James Blair surveyed E 1/2, NE 1/4, Section 13 and called for stone and bricks found  
 1925 Walter Frazier survey for MSHD "Cross on center of stone"  
 Oct. 4, 1948 Harold Clegg P.S. 13578 and I dug and found large stone, X on top 12" W. Cherry SE 28.95  
 1968 My son and I dug, found stone with cross and hub over. Drove iron pipe & bent top so as to be over stone.  
 Face of 12" W. Cherry SE 28.9  
 1972 I found 1/2" iron pipe over stone and recorded it in Liber 1, Page 325 Spike in 15" W. Cherry S 26° E 29.62  
 1999 Michael Bartolo found 3/4" iron pipe. Set dbl hd nail & disc in 12" Elm S 60° E 72.67


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 4, 2000 I found 1/2" iron pipe on N. side of stone (13" deep) with top bent south over cross & top hit and bent to west. Split the stone which was 15" high, 15" E & W 7" N & S to get it out of the ground. Found nothing else. Set 30" Harrison monument and placed the pieces of the stone around it. The top of the monument is 8" deep.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument and is accepted as the best available evidence of the position of the original corner.

Fd dbl hd nail & disc in 10" Elm S 70° E 72.66  
 Dbl hd. nail & re-mon tag in NE face 8" pine S 27° E 38.72  
 NE corner Brick face Hse #11515 S 10° W 124.66  
 NW corner conc. found Hse# 11515 S 34° W 147.10  
 Blair record to M-5 = 2645.94 Meas.= 2646.16

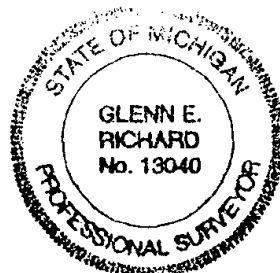

Ratified by Peer Group in accordance with P.A. 345 Co. Reg. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Nov. 29, 2000  
 Glenn E. Richard

Surveyor's Michigan License No. 13040