

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)


Located In:

Corner Code #



LIBER 2

PAGE 11

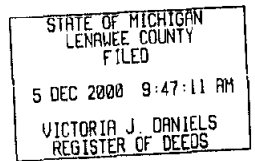

1. Public Land Survey

T -7- S R -5- E

L-11

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No.

Recorded Plat

5. Private Claims

I, Glenn E. Richardin a field survey on October 16, 2000

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1819 Joseph Fletcher D.S. Set 1/4 post Sycamore 8 N 50 E 17 Elm 9 N 20 E 29

1883 James Blair found corner; set stone with "X" on top

1926 This corner is shown on the DT&I R.O.W. map but not tied in by distance

1969 I dug but didn't find anything. I dug at the 1/8 corner to the West and found stone & added a iron pipe. I re-established the corner by extending the line east and doubling the distance between a found boat spike at the SW corner of Section 25 and the found stone.

1973 I found iron pipe & recorded it in Liber 2, Page 459 Cut "X" on N. end CMP N 40 W 21.52 Cut "X" on S. end CMP S 40 W 23.65

1978 Werner Sommer found iron pipe

2000 Michael Bartolo found 1/2" iron pipe

2000 David Erickson found 1/2" pipe Fd "X" on N. end CMP N 40 W 21.55. Fd. "X" on S. end CMP S 20 W 23.70

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 16, 2000 Found 1/2" X 27" iron pipe. I dug a hole to replace it with a 30" Harrison Monument and probed in all directions & hit a stone to the South. I uncovered the top of it but top appeared to be broken off. It is 1.2± south and 0.2± east of the found iron pipe. Set 30" Harrison Monument at the location of the found 1/2" iron pipe.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument stamped P.S. 13040 and is accepted as the best available evidence of the position of the original corner.

Fd. "X" cut on south end of CMP S 30° W 23.64

Fd. "X" cut on north end of CMP N 45° W 21.53

Set re-rod capped GER 13040 N 45° E 47.48 (on ROW's)

Found iron pipe south on east ditch bank south 32.94



Ratified by Peer Group in accordance with P.A. 345

Co. Rep

Glenn E. RichardDate September 26, 2000

Signed by

Glenn E. Richard

Date

Oct 23, 2000

Glenn E. Richard

Surveyor's Michigan License No. 13040

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

ADAPTED FOR WORD PROCESSING MARCH, 1993