

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)


Located In:

Corner Code #



LIBER 1

PAGE 413

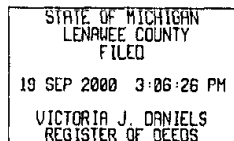

1. Public Land Survey T 8-S R 4-E C 7
T _____ R _____
T _____ R _____
T _____ R _____
2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
Property in Sec S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard, in a field survey on August 10, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler set post cor Sec. 17, 18, 19 & 20 W. Oak 14 N 21 E 18 Ash 12 S 34 W 9
1878 Survey by G.E. Kedzie, County Surveyor, called for stone
1882 & 1883 Surveys by James Blair "Found Corner"
1885 & 1886 Surveys by James Blair "Found Stone"
1907 & 1914 J.L. Richard found a stone
1972 I retraced Blair's surveys, dug and found stone under the pavement. I added a 3/4" X 4' iron pipe with top bent over the stone and recorded it in Liber 1, Page 297

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

August 10, 2000 Found monument box with broken top under 2" of asphalt pavement. Dug out the old box. Found 3/4" iron pipe with top bent with top over pointed stone. Broke off the top 14" of the iron pipe. Drilled a hole in the stone and set 5/8" X 17" re-rod in the hole with Lenawee County Re-mon cap stamped P.S. 13040. Set new monument box and patched existing pavement.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 17" re-rod in hole of stone with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

"X" cut on east end of CMP S 60° E 36.92
"X" cut on east end of CMP S 60° W 36.40
dbl hd nail & re-mon tag in E. face E.P. S 25° W 67.55
SE. corner of porch foundation Hse #9942 N 70° W 137.30
10' S of pavement centerline on Weston Rd.
5' W of pavement centerline of Hodges Hwy. to South



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 22, 2000

Signed by Glenn E. Richard Date Sept. 15, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040