

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee
(County)


Located In:

Corner Code #



LIBER 1

PAGE 431

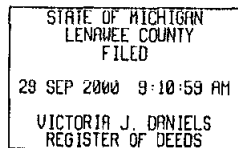

1. Public Land Survey T - 8-S R - 4-E C-11
T _____ R _____
T _____ R _____
T _____ R _____
2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
Property in Sec S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard, in a field survey on August 11, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler set post corner Sections 29, 30, 31 & 32 Ash 30 S 62 W 28 Lynn 14 N 64 E 27 1885 Survey by James Blair described the corner as stake & tile
1976 I dug but didn't find the corner described in Blair's survey. I retraced Blair's survey, set a 3/4" X 4' iron pipe and recorded it in Liber 3, Page 392
1995 Michael Bartolo dug using the witnesses shown on Liber 3, Page 392 and found the iron pipe 14" deep, raised with 1/2" iron pipe and recorded it in Liber 5, Page 251.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

August 11, 2000 Found 1/2" X 11" iron pipe over 3/4" iron pipe. Replaced them with 5/8" X 3' re-rod capped with Lenawee County Re-mon cap stamped P.S. 13040 and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

SE corner of concrete bridge abutment S 80° W 103.68
NE corner of concrete bridge abutment N 80° W 103.73
Fd nail & disc (added dbl hd nail & re-mon tag) in 20" Ash N 15° W 52.53
Fd nail & disc (added dbl hd nail & re-mon tag) in 50" Ash N 75° E 99.84
Fd nail & disc in E.P. S 65° E 108.39

The corner is 146' West of centerline of Hodges Hwy. to the South

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													



Ratified by Peer Group in accordance with P.A. 345 Co. Glenn E. Richard Date September 26, 2000

Signed by Glenn E. Richard Date Sept. 28, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040