

JAN 22 2001

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee

(County)


Located in:

Corner Code #



LIBER 2

PAGE 20

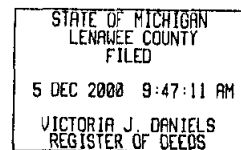

1. Public Land Survey T-8-S R-5-E D-7
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard, in a field survey on October 20, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler set 1/4 Sec. post Ash 14 N 77° W 14 W. Oak 11 S 89° E 12
1881 James Blair surveyed Section 20 "Found all the government corners except the East and West 1/4 posts. Corner is 4 1/2 links (2.97") north of line between section corners
Early 1900's J.L. Richard's records are same as James Blair
1977 Roger Meinke under my direction dug and found wood stake under a stone, set 3/4" X 30" iron rod in place of wood stake. Set stone next to iron rod and added pieces of tile. We found the corner 3.95 north of the line between the section corners. I recorded it in Liber 3, Page 543
1998 I found the 3/4" iron bar and witnessed it prior to road re-construction


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 20, 2000 Found 3/4" iron bar on S. side of stone. Set 5/8" X 3' re-rod on top and drove both down. Set Lenawee County Re-mon cap stamped P.S. 13040 and set monument box in base course of new asphalt pavement.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as a careful and faithful perpetuation of the position of the original corner.

Three re-rods capped GER 13040 on same line that I set in 1998
North (buried in field) 34.74
South 33.40'
South 76.81' (1.6 East of 10" Walnut)
This corner is in the center of the east bound lane
C-7 T8S R5E West 2629.63
E-7 T8S R5E East 2657.72

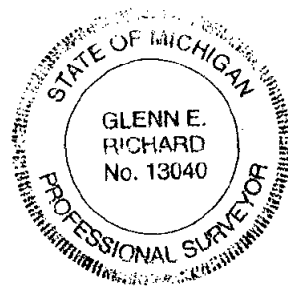

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Nov. 30, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040