

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Luce County Remonumentation Corner

MAR 13 2000

SECTION

For corners in

Luce County

Located in:

Corner Code #

1. Public Land Survey

T45N R10W

E-4/5 #3

2. Property Controlling
in Section

S
S

T
T

R
R

3. Miscellaneous
Property in Sec.

S
S

T
T

R
R

4. Lot No.

, Recorded Plat

5. Private Claims

LUCE COUNTY
REGISTER OF DEEDS
Recorded

Liber 3 Page 903
02-08-2000 13:01:16

Kathy S. Mahan
Kathy S. Mahan, Register
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on November 12, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:

E-4/5 Meander Corner Between Sections 8 & 9, T45N, R10W, on the North Side of Kak's Lake

1849 – Original corner established by William Ives, 6.80 chains north of the computed section corner, which fell in a small lake (Kak's Lake). No bearing trees are shown in the original notes.

1966 – Michigan Department of Transportation survey. Found an axle shaft 15 feet north of Kak's Lake. Witnesses:
12" Birch, N40°E 29.70'
12" Birch, S35°W 9.96'
3" Balsam Fir, N15°W 5.93'

1990 – Neil E. Hill, P.S. 27447, LCRC File No. 418, Luce County Corner Records. Found axle shaft. Witnesses:
7" Balsam Fir, N25°W 5.89'
12" Dead Birch, N75°E 29.62'
8" Twin Hard Maple, N10°W 23.10' (old bearing tree)
8" Balsam Fir, N25°E 36.62'

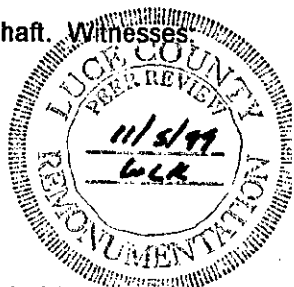

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Luce County Remonumentation Program. Found the axle shaft as noted in the above mentioned 1966 and 1990 records. Found axle shaft is 2186.1 feet south of the ¼ corner at E-4 to the north, GLO notes indicate a distance of 2191.2 feet. The only record bearing tree still standing is a balsam fir shown on the 1990 LCRC at N25°E 36.62'. Accepted the corner as found and established new bearing trees.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found an axle shaft at the corner location, on the north shore of Kak's Lake.

Witnesses:

Nail and MDOT tag in 7" Balsam Fir, N22°E 36.51'
Nail and tag #33142 in 12" blazed White Birch, N29°W 86.63'
Nail and tag #33142 in 6" blazed Balsam Fir, N88°E 26.33'
Nail and tag #33142 in 11" blazed Cedar, N11°W 35.65'

Signed by Keith R. Waters

Date 12-29-99

Surveyor's Michigan License No. 33142