

1993

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

LIVINGSTON
(County)

Located In:

Corner Code ~~==~~

- | 1. Public Land Survey | | T <u>3N</u> R <u>6E</u> | <u>K-12</u> |
|-------------------------|---------|-------------------------|-------------|
| | | T _____ R _____ | _____ |
| | | T _____ R _____ | _____ |
| | | T _____ R _____ | _____ |
| 2. Property Controlling | S _____ | T _____ R _____ | _____ |
| in Section | S _____ | T _____ R _____ | _____ |
| 3. Miscellaneous | S _____ | T _____ R _____ | _____ |
| Property in Sec. | S _____ | T _____ R _____ | _____ |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

L.S.C. #149m

Register of Deeds Stamp & File Number

MARY A. BARNWELL.

DECEMBER 6 10 93

MARY A. BARNWELL, in a field survey on DECEMBER 6, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-12 The West 1/4 Corner of Section 36, Hartland Township was set by the GLO in 1815 by Joseph Wampler.

The original witnesses are:

W. Oak 12" S30 1/2E 6 lks

W. Oak 10" N83 1/2W 59 lks

NOTE: NONE OF THE ORIGINAL WITNESSES COULD BE FOUND OR PERPETUATED
SEE THE BACK OF THIS SHEET FOR ADDITIONAL HISTORICAL DATA.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-12 Found 1/2" iron rod with Don Ross cap. Corner is at steel fence post, with intermittent fence extending north, south, east, and west.

NOTE : SEE THE DOSSIER AS FILED FOR THE LIVINGSTON COUNTY
REMONUMENTATION PROGRAM FOR ADDITIONAL INFORMATION
CONCERNING THIS CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

West 1/4 Corner, Section 36, T3N, R6E

Set 36" x 1 1/4" iron pipe with brass cap marked as "Livingston County Monument Corner"

N02°W Nail and tag in W side 18" Oak 34.24'

N30°W	Nail and tag in NE side 18" Oak	10.58'
-------	---------------------------------	--------

WEST	Nail and tag in N side 24" Oak	22.80'
------	--------------------------------	--------

S50°E	Nail and tag in SW side 36" Oak	17.61'
-------	---------------------------------	--------

APPROVED BY THE LIVINGSTON COUNTY MONUMENTALIZATION PEER GROUP OCT. 30 1993.

Signed by James J. [Signature]

Surveyor's Michigan License No. 33971

MARY A.
BARNWELL
PROFESSIONAL
SURVEYOR
No.
33971

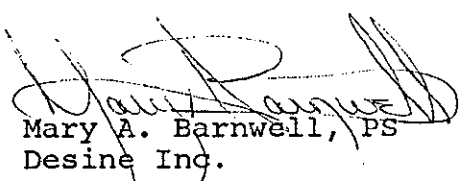
DECEMBER 24, 1993

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983

October 30, 1993

K-12, T3N, R6E: WEST 1/4 CORNER, SECTION 36, HARTLAND TOWNSHIP

Found 1/2" Iron Rod with Donald W. Ross cap. Iron is at steel fence corner post with intermittent fence extending north, east, west and south. The terrain is rolling and wooded to the north, and rolling, wooded and swampy to the south. The only Survey of record is that by Boss in 1988 which uses the Ross iron. Ross iron and fence intersection are located approximately 4.0 feet south of the midpoint of the Section Line. A sweep of the area found no additional irons. I recommend accepting the West 1/4 Corner at the location as is presently monumented.


Mary A. Barnwell, PS
Desine Inc.

